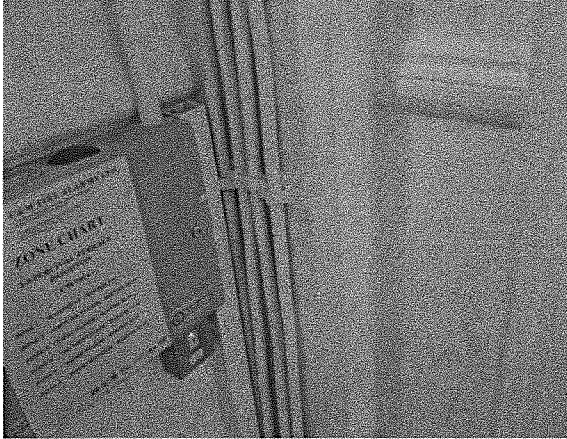

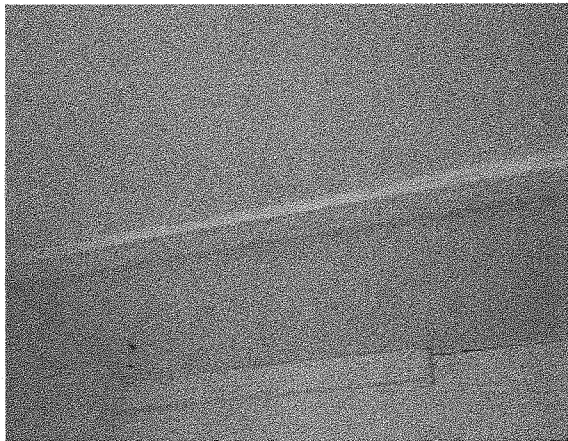
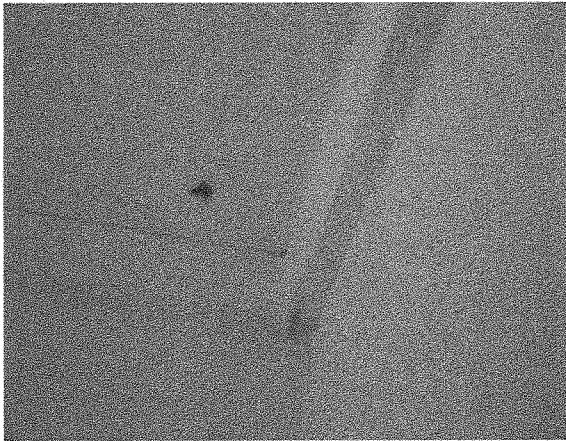
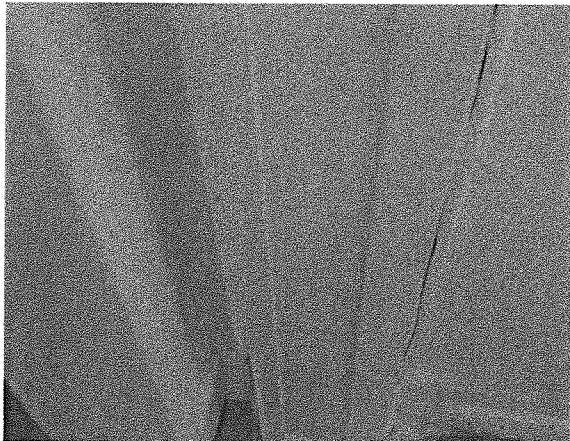
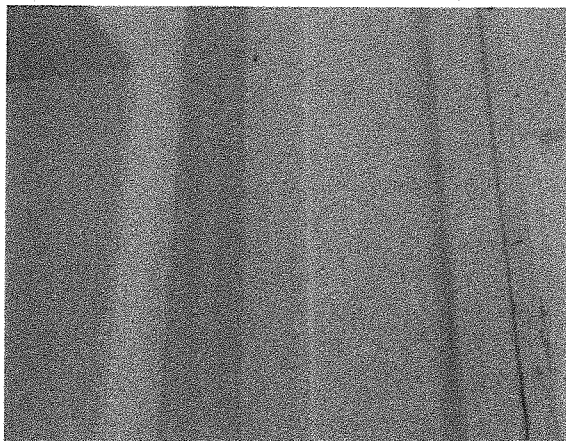


Material Assessment Record

Item	Building	Level	Location / Room number	Survey Type	Quantity	Sample Reference
1	Domestic	Ground Floor	G.001 - Hall	Management Survey (with MA only)	4lm	QR000216
						
Material Description				Material Risk		
Boxing adjacent to alarm box – Cement Asbestos Cement				Product Type	1	Surface Treatment
				Extent of Damage	0	Asbestos Type
Asbestos Type				Score - Material Risk		
Chrysotile				3		Very Low
Additional Information				Accessibility		
N/A				Easily disturbed		
Recommendations				Review Date		
Label & Manage				May 2019		

Item	Building	Level	Location / Room number	Survey Type	Quantity	Sample Reference	
5	Domestic	Ground Floor	G.005 - Hall adjacent to 15	Management Survey (with MA only)	4m²	QR000217	
							
Material Description				Material Risk			
Ceiling – Insulation board Asbestos Insulating Board				Product Type	2	Surface Treatment	1
				Extent of Damage	0	Asbestos Type	3
Asbestos Type				Score - Material Risk			
Chrysotile + Crocidolite				6		Low	
Additional Information				Accessibility			
Part plasterboard ceiling				Usually inaccessible or unlikely to be disturbed			
Recommendations				Review Date			
Label & Manage				May 2019			

Item	Building	Level	Location / Room number	Survey Type	Quantity	Sample Reference	
10	Domestic	4th Floor	4.003 - Hall 55-60	Management Survey (with MA only)	2lm	QR000220	
							
Material Description				Material Risk			
Riser panel – Cement Asbestos Cement				Product Type	1	Surface Treatment	1
				Extent of Damage	0	Asbestos Type	1
Asbestos Type				Score - Material Risk			
Chrysotile				3		Very Low	
Additional Information				Accessibility			
N/A				Easily disturbed			
Recommendations				Review Date			
Label & Manage				May 2019			

