

Site Asbestos Compendium Summary

This compendium report is based on Site id: **171166**, Client Site Ref: **Regent Centre Metro Station**, Client Ref: **Regent Centre Metro Station**, Account Ref No: **3074**

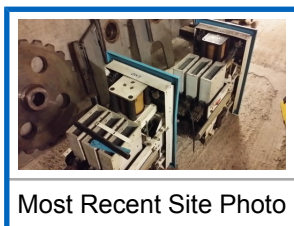
Regent Centre Metro Station, Great North Road Newcastle Upon Tyne, NE3 5JN

This Site Asbestos Compendium Summary report has been produced at the request of Tyne and Wear Metro T/a Nexus it is a summary of asbestos survey findings. Not all of this buildings or items within may have been surveyed for asbestos containing materials - check for exceptions below. Information in this report should not be regarded as an exhaustive inventory of all asbestos containing materials on these premises. Any proposed work of an intrusive nature in the vicinity of asbestos containing material as identified in this summary **MUST** in the first instance be referred to Tyne and Wear Metro T/a Nexus building and civil section.

This Compendium Asbestos report aims to be concise, yet comprehensive compilation of asbestos records relating to *Regent Centre Metro Station, Great North Road Newcastle Upon Tyne, NE3 5JN*. This compendium will summarize larger work shown in individual reports undertaken for jobs carried out on this site.

The full Site Asbestos Compendium report can be found at:
<https://web.lucion.co.uk/print/compendium/171166?s=31e03d0f3d03f254e3972c2b9790f3b7>

Cover Photo




Most Recent Site Photo

Overview of Jobs carried out at this Site

Job ID	Job-Type	Start Date	Due Date
187928	Survey, Management		
211886	Bulk ID	Thursday, 20th July, 2017	Thursday, 20th July, 2017
347951	Survey, Reinspection	Tuesday, 16th July, 2019	Monday, 6th April, 2020

Breakdown of Asbestos findings

⊖ Asbestos should be presumed to be present within Locations and Items not accessed until further assessment. 
Additional surveyor comments.

Head Office

E:
T:

Issuing Office:

[↓ Previous Asbestos Records](#)
[Most Recent Asbestos Records ↓](#)

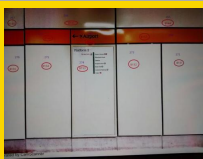




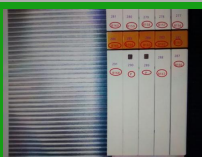

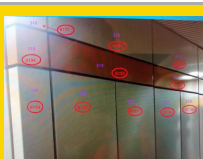






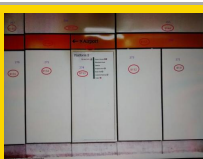




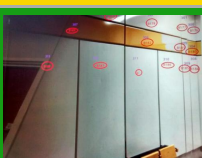







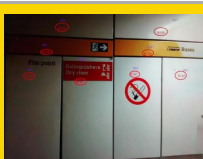



Building: Regent Centre Metro Station				Level: -1	Location: 001/Lift 2 Lobby		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 265	Insulating board Insulating board	Amosite Amosite	7 --	-- 1 No.	-- --	 ERROR
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 282	No asbestos identified	NAD	-- --	-- --	-- --	 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 321	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 298	No asbestos identified	NAD	-- --	-- --	-- --	 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 275	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 304	No asbestos identified	NAD	-- --	-- --	-- --	 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 264	No asbestos identified	NAD	-- --	-- --	-- --	 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 268	No asbestos identified	NAD	-- --	-- --	-- --	 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 257	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						

table continued from previous page...























Building: Regent Centre Metro Station				Level: -1	Location: 001/Lift 2 Lobby		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 310	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 307	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 308	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 288	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 291	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 319	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 305	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 322	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 271	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...






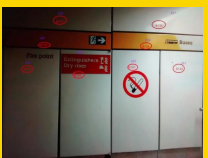








Building: Regent Centre Metro Station			Level: -1	Location: 001/Lift 2 Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 285	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 261	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 320	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 258	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 315	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 300	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 262	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 324	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 303	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...

Building: Regent Centre Metro Station			Level: -1	Location: 001/Lift 2 Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 276	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 293	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 259	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 272	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 295	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 260	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 269	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 274	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 266	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...








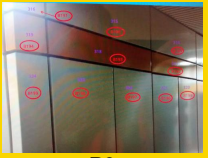





Building: Regent Centre Metro Station			Level: -1	Location: 001/Lift 2 Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 318	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 313	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 306	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 286	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 323	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 314	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 284	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 302	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 316	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...








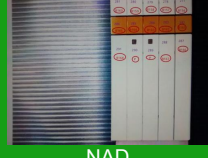



Building: Regent Centre Metro Station			Level: -1	Location: 001/Lift 2 Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 263	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 297	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 279	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 296	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 278	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 283	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 301	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 280	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 287	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



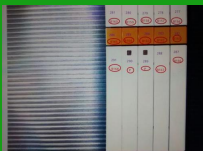









Building: Regent Centre Metro Station			Level: -1	Location: 001/Lift 2 Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 312	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 277	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 281	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 299	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- --	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 273	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 292	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 267	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 294	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 317	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Regent Centre Metro Station			Level: -1	Location: 001/Lift 2 Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 270	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 309	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 394	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 395	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 396	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 397	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 398	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 399	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 400	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...











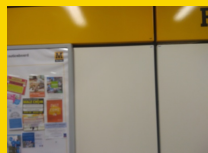
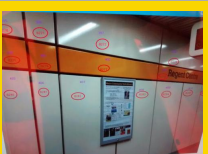

Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 401	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 402	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 403	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 404	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 405	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 406	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 407	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 408	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 409	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...




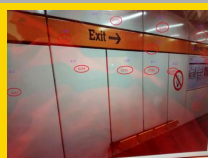

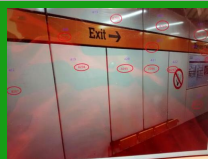


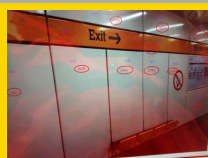

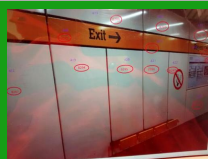
Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 410	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 411	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 412	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 413	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 414	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 415	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 416	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 417	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 418	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...













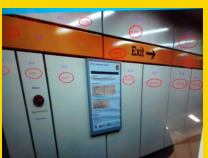











Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 424	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
	IB lining to VE panel 425	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 426	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 427	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 429	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							
 R3	IB lining to VE panel 430	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
	IB lining to VE panel 432	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 433	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							
 R3	IB lining to VE panel 434	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							

table continued from previous page...



















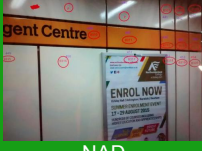



Building: Regent Centre Metro Station				Level: -1	Location: 002/Platform 2		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 435	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 436	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 437	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 438	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 441	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 442	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 443	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 444	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 445	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...


Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 446	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 447	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 448	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 449	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 450	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 451	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 452	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 453	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 454	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 455	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 456	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 457	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 458	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 459	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 460	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 461	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 462	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 463	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...











Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 464	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 465	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 466	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 467	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 468	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 469	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 470	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 471	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 472	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



















Building: Regent Centre Metro Station				Level: -1	Location: 002/Platform 2		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 473	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 474	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 475	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 476	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 477	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 478	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 479	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 480	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 481	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...







Building: Regent Centre Metro Station				Level: -1		Location: 002/Platform 2	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 482	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 483	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 484	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 485	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 486	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 487	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 488	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 489	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 490	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...














Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 356	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 354	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 391	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 375	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 362	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 339	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 332	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 385	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 345	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...














Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 341	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 327	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 367	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 349	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 --	-- 1 No.	-- Reinspect Periodically	 ERROR
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 373	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 382	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 374	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 387	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 360	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...












Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 380	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 353	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 351	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 383	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 333	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 335	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 369	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 359	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- --	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 368	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


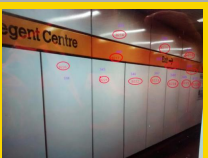

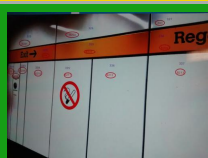

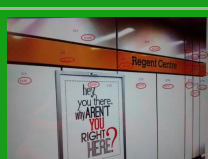


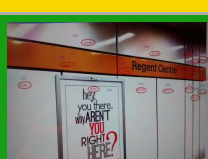
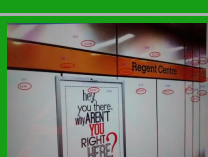
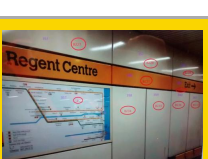
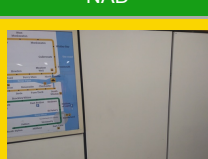
Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 381	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 346	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 330	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 326	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 363	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 377	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 365	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 371	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 358	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...








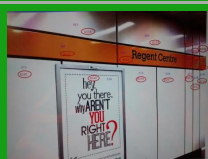
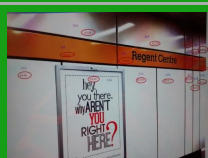
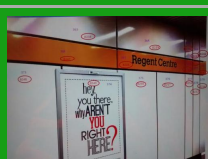
Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 392	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 379	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 388	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 348	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 337	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 352	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 366	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 370	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 364	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...









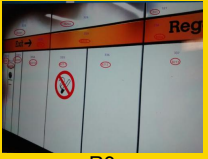

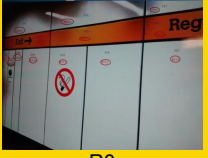
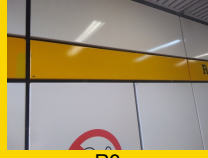

Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 386	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 336	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 350	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 355	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 384	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 328	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 325	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 329	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 340	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...








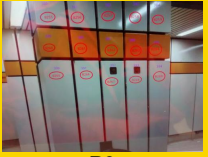





Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 338	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 393	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 378	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 331	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 390	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 389	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 334	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 343	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 376	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...



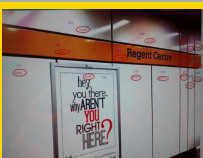




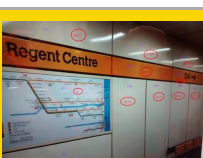



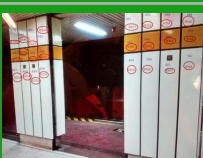

Building: Regent Centre Metro Station			Level: -1	Location: 002/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 342	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	IB lining to VE panel 372	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	IB lining to VE panel 347	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
	IB lining to VE panel 344	No asbestos identified	NAD	--	--		 NAD
(inspected during Survey, Survey, Management)							
 R3	IB lining to VE panel 361	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
Building: Regent Centre Metro Station			Level: -1	Location: 003/Platform 2 Escalator Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 491	No asbestos identified	NAD	--	--		 NAD
(inspected during Survey, Survey, Management)							
	IB lining to VE panel 492	No asbestos identified	NAD	--	--		 NAD
(inspected during Survey, Survey, Management)							
	IB lining to VE panel 493	No asbestos identified	NAD	--	--		 NAD
(inspected during Survey, Survey, Management)							
	IB lining to VE panel 494	No asbestos identified	NAD	--	--		 NAD
(inspected during Survey, Survey, Management)							

table continued from previous page...

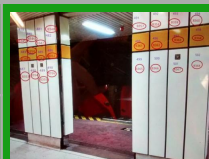









Building: Regent Centre Metro Station				Level: -1		Location: 003/Platform 2 Escalator Lobby	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 495	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 496	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 497	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 498	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 499	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 500	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 501	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 502	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 503	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...




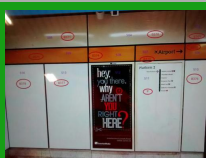

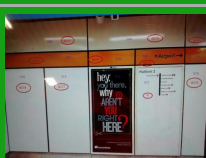
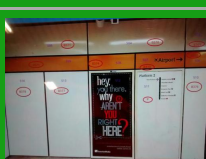
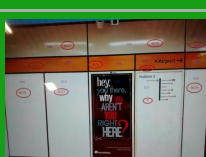




















Building: Regent Centre Metro Station			Level: -1		Location: 003/Platform 2 Escalator Lobby		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 504	Insulating board Insulating board	Amosite Amosite	7 --	-- 1 No.	-- Reinspect Periodically	 ERROR
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 505	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 506	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Remove if likely to be disturbed by proposed works	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 507	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 508	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 509	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 510	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 513	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 514	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Remove if likely to be disturbed by proposed works	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...

Building: Regent Centre Metro Station			Level: -1		Location: 003/Platform 2 Escalator Lobby		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 515	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 516	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 517	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 518	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 519	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 520	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 521	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 522	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 523	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1		Location: 003/Platform 2 Escalator Lobby	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 524	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	<div> (inspected during Survey, Survey, Management)</div> <div> Item condition unaltered since last inspection.</div>						
	IB lining to VE panel 525	No asbestos identified	NAD	--	--		 NAD
	<div> (inspected during Survey, Survey, Management)</div>						
	IB lining to VE panel 526	No asbestos identified	NAD	--	--		 NAD
	<div> (inspected during Survey, Survey, Management)</div>						
 R3	IB lining to VE panel 527	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	<div> (inspected during Survey, Survey, Management)</div> <div> Item condition unaltered since last inspection.</div>						
	IB lining to VE panel 528	No asbestos identified	NAD	--	--		 NAD
	<div> (inspected during Survey, Survey, Management)</div>						
	IB lining to VE panel 529	No asbestos identified	NAD	--	--		 NAD
	<div> (inspected during Survey, Survey, Management)</div>						
	IB lining to VE panel 530	No asbestos identified	NAD	--	--		 NAD
	<div> (inspected during Survey, Survey, Management)</div>						





Building: Regent Centre Metro Station			Level: -1		Location: 004/Platform 2 Escalator And Stairwell		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
R3	IB lining to VE panel 532	<i>Insulating board</i> Insulating board	<i>Amosite</i> Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 534	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 535	No asbestos identified	NAD	--	--		NAD

table continued from previous page...


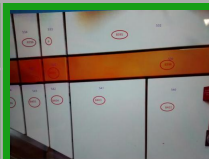
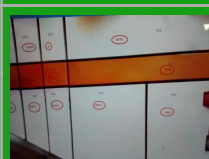
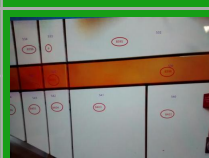
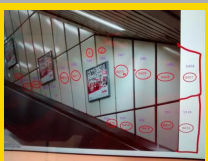
Building: Regent Centre Metro Station			Level: -1		Location: 004/Platform 2 Escalator And Stairwell		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 536	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 537	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 538	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 539	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 540	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 541	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 542	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 543	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 544	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 545A	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...

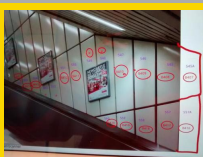



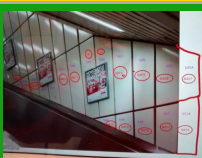

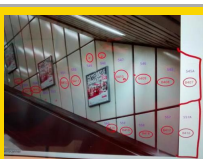



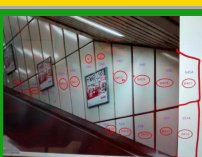

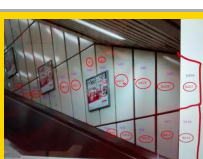



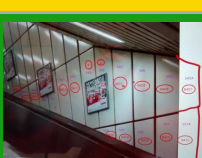

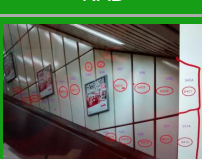

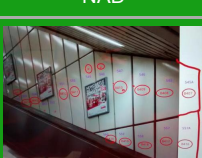



Building: Regent Centre Metro Station			Level: -1		Location: 004/Platform 2 Escalator And Stairwell		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 545	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 546	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 547	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 550	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 551	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 554	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 555	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 556	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 557A	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...



Building: Regent Centre Metro Station				Level: -1		Location: 004/Platform 2 Escalator And Stairwell	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 557	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 558	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 559	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 586	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 560	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 587	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 590	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 591	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 614	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 615	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 616	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 619	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 620	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 621	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 622	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 600	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 601	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 602	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 603	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 604	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 605	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 606	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 607	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 608	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 609	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 610	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 611	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

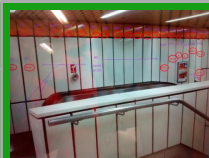




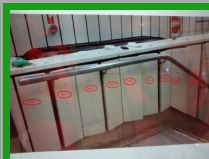

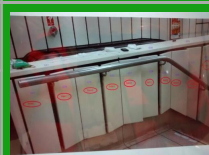

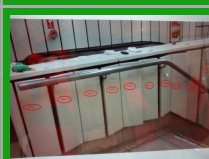









Building: Regent Centre Metro Station				Level: -1		Location: 004/Platform 2 Escalator And Stairwell	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 612	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 613	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 623	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 624	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 625	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 626	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 627	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 628	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 629	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 630	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

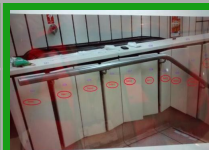
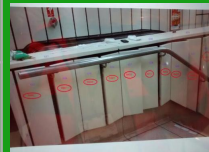
Building: Regent Centre Metro Station				Level: -1		Location: 004/Platform 2 Escalator And Stairwell	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 631	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 632	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 633	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 634	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 635	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 641	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 642	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 643	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 644	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 645	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 646	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 647	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 648	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 649	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 650	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 651	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 652	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 653	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...












Building: Regent Centre Metro Station			Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 654	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 655	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 656	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 657	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 658	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 660	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 661	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	IB lining to VE panel 662	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 663	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...







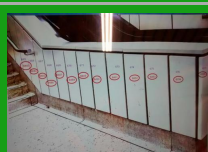



Building: Regent Centre Metro Station			Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 664	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 665	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 659	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 666	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 667	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 668	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 669	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 670	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 671	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...






Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 672	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 673	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 674	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 675	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 676	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 677	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 678	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 679	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 680	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 681	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 682	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 683	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 685	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 686	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 687	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 688	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 689	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 684	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

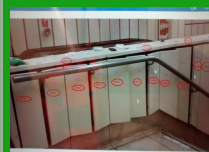
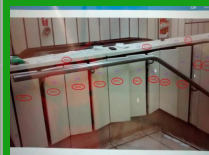
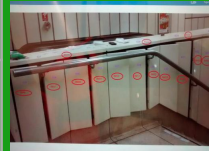


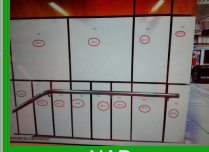
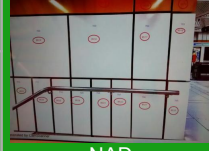
Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 640	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 639	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 638	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 637	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 636	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 698	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 699	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 700	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 701	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

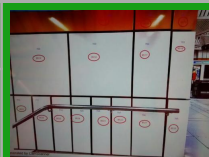



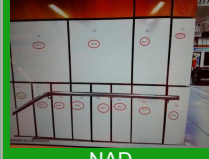
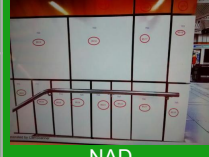

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 702	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 703	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 704	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 705	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 706	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 707	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 708	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 709	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 710	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...










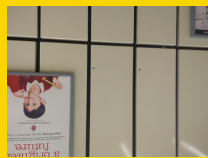


Building: Regent Centre Metro Station			Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 711	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 712	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 717	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 725	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 726	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 727	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 728	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 731	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 732	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 733	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 734	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 741	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 742	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 743	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 744	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 745	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 746	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 747	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 748	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 751	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 754	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 755	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 758	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 759	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 760	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 761	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 762	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

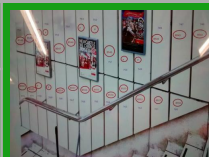
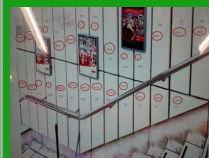






Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 763	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 764	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 767	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 768	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 771	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 772	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 775	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 776	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 779	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Regent Centre Metro Station			Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 780	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 781	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 782	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 783	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 784	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 785	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 786	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 787	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 788	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 789	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 790	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 791	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 792	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 793	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 794	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 795	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 796	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 797	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Regent Centre Metro Station				Level: -1	Location: 004/Platform 2 Escalator And Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 798	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 799	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 800	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
Building: Regent Centre Metro Station				Level: 0	Location: 001/Maintenance corridor			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Gasket to pipework	Composites	Chrysotile	2	--	--	 R3	
	(inspected during Survey, Survey, Management)							
Building: Regent Centre Metro Station				Level: 0	Location: 002/Battery room			
No reportable Items and Materials recorded at this Location								
Building: Regent Centre Metro Station				Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 002	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 003	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 004	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	IB lining to VE panel 005	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...






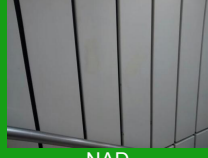



Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 010	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 011	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 012	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 013	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 014	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 015	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 016	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 017	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 056	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

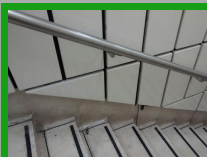









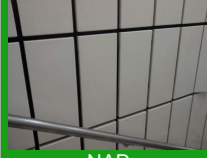





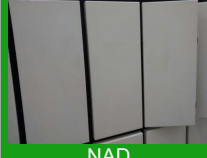

Building: Regent Centre Metro Station				Level: 0	Location: 002/Lift 2 Stairwell		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 057	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 058	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 059	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 060	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 061	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 062	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 063	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 064	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 065	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...


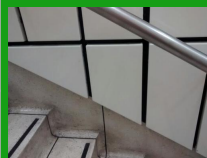







Building: Regent Centre Metro Station				Level: 0	Location: 002/Lift 2 Stairwell		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 066	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 067	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 068	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 069	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 070	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 071	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 072	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 073	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 074	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...













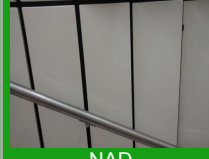

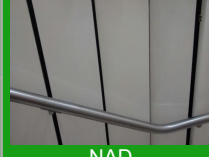



Building: Regent Centre Metro Station				Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 075	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 076	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 077	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 078	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 079	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 080	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 085	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 086	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 087	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							

table continued from previous page...




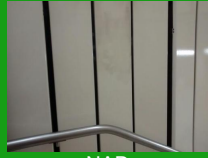






Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 088	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 089	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 090	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 091	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 092	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 093	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 094	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 095	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 096	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...







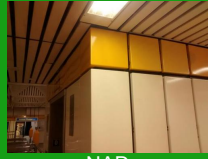




Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 097	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 098	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 099	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 100	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 001	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 101	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 111	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 112	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 113	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


Building: Regent Centre Metro Station				Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	IB lining to VE panel 114	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 115	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 116	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 117	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 118	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 120	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 119	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 110	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 139	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							

table continued from previous page...



















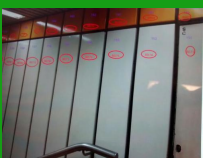

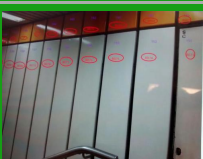

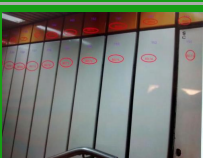

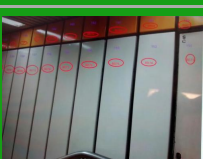

Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 140	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 141	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 142	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 143	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 144	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 151	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 152	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 153	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 154	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...














Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 155	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 156	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 157	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 158	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 159	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 163	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 164	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 165	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 166	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...











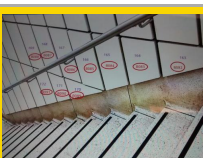



















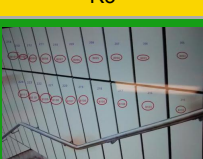

Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 167	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 168	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 169	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 170	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 171	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 172	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 205	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 206	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 207	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...























Building: Regent Centre Metro Station				Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
 R3	IB lining to VE panel 208	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3	
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
 R3	IB lining to VE panel 210	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3	
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
	IB lining to VE panel 209	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 211	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 212	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 213	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 214	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 215	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							
	IB lining to VE panel 216	No asbestos identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							

table continued from previous page...























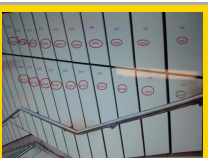





Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 217	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 218	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 219	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 220	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 221	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 222	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	IB lining to VE panel 223	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 224	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	IB lining to VE panel 225	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 226	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 232	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	IB lining to VE panel 233	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 234	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 236	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 237	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 238	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 239	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 240	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...





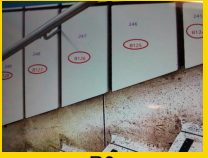




















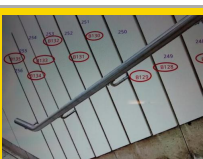









Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	IB lining to VE panel 241	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 242	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 245	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	IB lining to VE panel 246	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 247	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 248	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 249	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	IB lining to VE panel 250	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	IB lining to VE panel 251	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						



table continued from previous page...

Building: Regent Centre Metro Station			Level: 0	Location: 002/Lift 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	IB lining to VE panel 252	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
 R3	IB lining to VE panel 253	Insulating board Insulating board	Amosite Amosite	7 7	-- 1 No.	-- Reinspect Periodically	 R3
 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
	IB lining to VE panel 254	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							
 R3	IB lining to VE panel 255	Insulating board Insulating board	Amosite Amosite	7 7	-- --	-- Reinspect Periodically	 R3
 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
 PRESUME	IB lining to VE panel	Insulating board insulating board	-- Presume Amosite	-- 7	-- 1 No.	-- Reinspect Periodically	 R3
 (inspected during Survey, Survey, Management)  No access gained to various VE panels due to height restrictions/unsafe access above staircases/ electrical installations. 006-009, 018-055, 081-084, 102-109, 121-138, 145-162, 173-204, 235, 243, 244							
	IB lining to VE panel 256	No asbestos identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							

Building: Regent Centre Metro Station Level: 0 Location: 003/Redundant basement stairwell

No reportable Items and Materials recorded at this Location

Building: Regent Centre Metro Station Level: 0 Location: 004/Maintenance power corridor

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Panels within doorhead panels	No Asbestos Identified	NAD	--	--		 NAD
 (inspected during Survey, Survey, Management)							

Building: Regent Centre Metro Station Level: 0 Location: 005/C & S Room

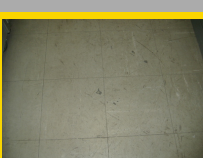

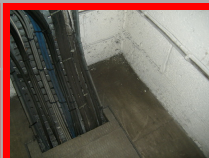

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Floor tile	Composites	Chrysotile	2	--	--	 R3
 (inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Regent Centre Metro Station				Level: 0	Location: 005/C & S Room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Debris to floor below cables	Loose Insulation	Chrysotile	10	--	--	 R1	
	 (inspected during Survey, Survey, Management)							
	Debris to cabinets	No Asbestos Identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							

Building: Regent Centre Metro Station				Level: 0	Location: 006/HV room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Plant and Equipment	Limited Access Gained	--	--	--			
	 Limited Access:  (inspected during Survey, Survey, Management)							
	Debris to underfloor	No Asbestos Identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							

Building: Regent Centre Metro Station				Level: 0	Location: 007/LV room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Gasket to ventilation ductwork	No Asbestos Identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							

Building: Regent Centre Metro Station				Level: 0	Location: 008/C & S storeroom			
No reportable Items and Materials recorded at this Location								

Building: Regent Centre Metro Station				Level: 0	Location: 009/Redundant lift shaft and stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Panels to lift shift	No Asbestos Identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							


Building: Regent Centre Metro Station				Level: 0	Location: 010/Basement archive room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Debris to deckhead	No Asbestos Identified	NAD	--	--		 NAD	
	 (inspected during Survey, Survey, Management)							

table continued from previous page...

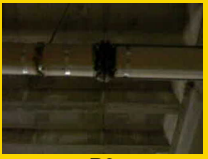














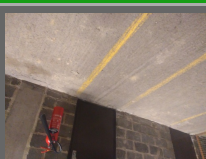


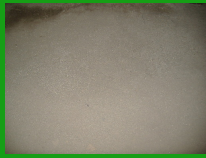



















Building: Regent Centre Metro Station			Level: 0	Location: 010/Basement archive room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Gaskets to pipework	Composites Composites	Chrysotile Chrysotile	2 2	-- 6 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
 R1	Debris to floor	Loose Insulation Loose Insulation - removed	Chrysotile --	10 --	-- --	--	 REMOVED
	 (inspected during Survey, Survey, Management)  Item has been removed since last inspection [187928].						
 R1	Debris to floor	Loose Insulation Loose Insulation	Amosite --	11 --	-- --	--	 REMOVED
	 (inspected during Survey, Survey, Management)  Item has been removed since last inspection [187928].						
	Debris to floor	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R1	Debris to floor adjacent battery room wall	Loose Insulation Loose Insulation - removed	Chrysotile --	10 --	-- --	--	 REMOVED
	 (inspected during Survey, Survey, Management)  Item condition has deteriorated since last inspection.						
	Debris to floor adjacent to the cages	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Debris to floor adjacent wall	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R1	Debris to floor adjacent archive cage	Loose Insulation Loose Insulation - removed	Chrysotile --	10 --	-- --	--	 REMOVED
	 (inspected during Survey, Survey, Management)  Item has been removed since last inspection [187928].						
 R1	Debris to floor adjacent wall	Loose Insulation Loose Insulation - removed	Chrysotile --	10 --	-- --	--	 REMOVED
	 (inspected during Survey, Survey, Management)  Item has been removed since last inspection [187928].						

table continued from previous page...

Building: Regent Centre Metro Station			Level: 0	Location: 010/Basement archive room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R1	Debris to floor	Loose Insulation Loose Insulation - removed	Chrysotile --	10 --	-- --	--	 REMOVED
(inspected during Survey, Survey, Management) Item has been removed since last inspection [187928].							
 R1	Debris to floor adjacent cage	Loose Insulation Loose Insulation - removed	Chrysotile --	10 --	-- --	--	 REMOVED
(inspected during Survey, Survey, Management) Item has been removed since last inspection [187928].							
 R1	Debris to floor adjacent wall	Loose Insulation Loose Insulation.- removed	Amosite --	11 --	-- --	--	 REMOVED
(inspected during Survey, Survey, Management) Item has been removed since last inspection [187928].							
 R3	internal panels within Ottermill 415v unit	cement cement - removed	Chrysotile --	4 --	0.5 Sqm. within 2 units 0.5 Sqm. within 2 units	Remove	 REMOVED
Item has been removed since last inspection [211886].							

Building: Regent Centre Metro Station Level: 0 Location: 011/Escalator machine room

No reportable Items and Materials recorded at this Location

Building: Regent Centre Metro Station Level: 0 Location: 012/Lift machine room

No reportable Items and Materials recorded at this Location

Building: Regent Centre Metro Station Level: 0 Location: 013/Station platform 2



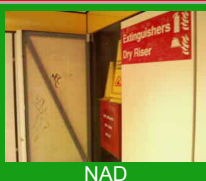




First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Panel to fire extinguisher dry riser	No Asbestos Identified	NAD	--	--		 NAD
(inspected during Survey, Survey, Management)							
	VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
(inspected during Survey, Survey, Management)							
	Panels to Fire extinguisher dry riser	No Asbestos Identified	NAD	--	--		 NAD
(inspected during Survey, Survey, Management)							



table continued from previous page...

Building: Regent Centre Metro Station			Level: 0	Location: 013/Station platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Residue to platform canopy	No Asbestos Identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						

Building: Regent Centre Metro Station			Level: 0	Location: 014/Station platform 1			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Residue to platform canopy	No Asbestos Identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Panels to Fire extinguisher dry riser	No Asbestos Identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
	💬 (inspected during Survey, Survey, Management)						

Building: Regent Centre Metro Station			Level: 0	Location: 015/Archive store			
No reportable Items and Materials recorded at this Location							

Building: Regent Centre Metro Station			Level: 0	Location: 016/Lift machine room			
No reportable Items and Materials recorded at this Location							

Building: Regent Centre Metro Station			Level: 1	Location: 001/Ticket concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
	💬 (inspected during Survey, Survey, Management)						
	Panels to Fire extinguisher dry riser	No Asbestos Identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						

Building: Regent Centre Metro Station			Level: 1	Location: 001/Ticket concourse - Ceiling Void			
No reportable Items and Materials recorded at this Location							

Building: Regent Centre Metro Station				Level: 1	Location: 002/Newsagent kiosk			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Whole location	No Access Gained	--	--	--			
	<div><div></div>Limited Access:  (inspected during Survey, Survey, Management)</div>							

Building: Regent Centre Metro Station				Level: 1	Location: 003/Plant store room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Debris to doorheader	No Asbestos Identified	NAD	--	--		 NAD	
	<div> (inspected during Survey, Survey, Management)</div>							
	Packing to doorframe	Ropes, Cloths & Yarns	--	--	--	--	 PRESUME	
	<div> (inspected during Survey, Survey, Management)</div>							

Building: Regent Centre Metro Station				Level: 1	Location: 004/Staff lobby area			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Floor tiles	No Asbestos Identified	NAD	--	--		 NAD	
	<div> (inspected during Survey, Survey, Management)</div>							

Building: Regent Centre Metro Station				Level: 1	Location: 005/Cleaners cupboard			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Floor tiles	No Asbestos Identified	NAD	--	--		 NAD	
	<div> (inspected during Survey, Survey, Management)</div>							
	Frame packers	No Asbestos Identified	NAD	--	--		 NAD	
	<div> (inspected during Survey, Survey, Management)</div>							

Building: Regent Centre Metro Station				Level: 1	Location: 006/Staff Room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Floor tiles	No Asbestos Identified	NAD	--	--		 NAD	
	<div> (inspected during Survey, Survey, Management)</div>							

table continued from previous page...

Building: Regent Centre Metro Station			Level: 1	Location: 006/Staff Room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Sink pad	No Asbestos Identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD

Building: Regent Centre Metro Station			Level: 1	Location: 007/Fire Exit Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Floor tiles	Composites	Chrysotile	3	--	--	
	 (inspected during Survey, Survey, Management)						R3

Building: Regent Centre Metro Station			Level: 1	Location: 008/Connaught Office			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Floor tiles	No Asbestos Identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD

Building: Regent Centre Metro Station			Level: 1	Location: 009/Gentlemans Toilet			
No reportable Items and Materials recorded at this Location							

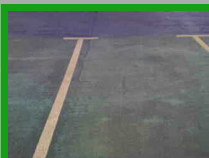



Building: Regent Centre Metro Station			Level: 1	Location: 010/Ladies Toilet			
No reportable Items and Materials recorded at this Location							

Building: Regent Centre Metro Station			Level: 1	Location: 011/Car Park Stairwell			
No reportable Items and Materials recorded at this Location							

Building: Regent Centre Metro Station			Level: 1	Location: 012/Redundant Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Gasket to pipework	Friction Products	Chrysotile	2	--	--	
	 (inspected during Survey, Survey, Management)						R3

Building: Regent Centre Metro Station			Level: 1	Location: 013/Lift shaft			
No reportable Items and Materials recorded at this Location							

Building: Regent Centre Metro Station			Level: 1	Location: 014/Lift shaft			
No reportable Items and Materials recorded at this Location							

Building: Regent Centre Metro Station			Level: 99	Location: 001/Car Park all levels			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Floor	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	External VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
	 (inspected during Survey, Survey, Management)						