

Site Asbestos Compendium Summary

This compendium report is based on Site id: **171124**, Client Site Ref: **Heworth Metro Station**, Client Ref: **Heworth Metro Station**, Account Ref No: **3074**

Heworth Metro Station, Sunderland Road, Heworth, Gateshead, NE10 0NJ

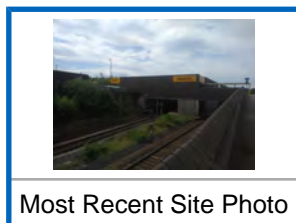
This Site Asbestos Compendium Summary report has been produced at the request of Tyne and Wear Metro T/a Nexus it is a summary of asbestos survey findings. Not all of this buildings or items within may have been surveyed for asbestos containing materials - check for exceptions below. Information in this report should not be regarded as an exhaustive inventory of all asbestos containing materials on these premises. Any proposed work of an intrusive nature in the vicinity of asbestos containing material as identified in this summary **MUST** in the first instance be referred to Tyne and Wear Metro T/a Nexus building and civil section.

This Compendium Asbestos report aims to be concise, yet comprehensive compilation of asbestos records relating to *Heworth Metro Station, Sunderland Road, Heworth, Gateshead, NE10 0NJ*. This compendium will summarize larger work shown in individual reports undertaken for jobs carried out on this site.

The full Site Asbestos Compendium report can be found at:

<https://web.lucion.co.uk/print/compendium/171124?s=f106fb6cec5a6690707cb275853dca5f>


Cover Photo



Overview of Jobs carried out at this Site

Job ID	Job-Type	Start Date	Due Date
187869	Survey, Management		
348282	Survey, Reinspection	Wednesday, 17th July, 2019	Tuesday, 31st March, 2020

Breakdown of Asbestos findings

⊖ Asbestos should be presumed to be present within Locations and Items not accessed until further assessment. 
Additional surveyor comments.

Head Office

E:
T:

Issuing Office:

[↓ Previous Asbestos Records](#)
[Most Recent Asbestos Records ↓](#)


Building: Heworth Metro Station **Level: -1** **Location: 001/LV Room**

No reportable Items and Materials recorded at this Location



Building: Heworth Metro Station **Level: -1** **Location: 002/Comms Room**

No reportable Items and Materials recorded at this Location

Building: Heworth Metro Station **Level: -1** **Location: 003/Relay Room**

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Beige floor tiles	vinyl tile	Chrysotile	3	20 Sqm.	Reinspect Periodically	R3
	 Item condition unaltered since last inspection.						

Building: Heworth Metro Station **Level: -1** **Location: 004/Escalator Void**

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to access hatch	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

Building: Heworth Metro Station **Level: -1** **Location: 005/Lift Motor Room**

No reportable Items and Materials recorded at this Location

Building: Heworth Metro Station **Level: -1** **Location: 006/Platform 1**

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1523	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1524-1526	Insulating board	--	--	--	--	 PRESUME
	 (inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1379-1388	<i>Insulating board</i> Insulating board	-- Presume Amosite	-- 8	-- 10 No	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)						
	 Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 1389	<i>Insulating board</i> Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)						
	 Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1390	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...






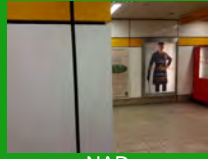

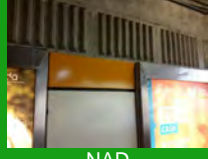



Building: Heworth Metro Station			Level: -1	Location: 006/Platform 1			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1391	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1392	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1393	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1394-1395	Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1396	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1397	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1398	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1399	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1400-1410	Insulating board	-- Presume Amosite	-- 8	-- 11 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...


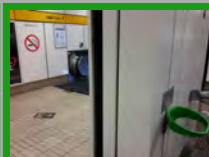


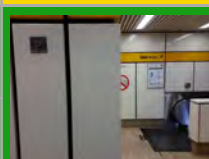
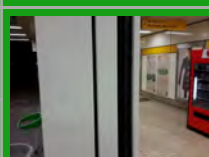
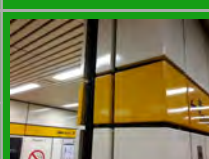

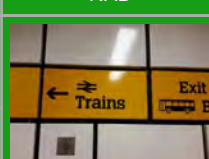
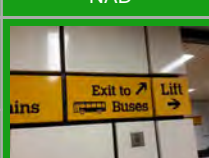
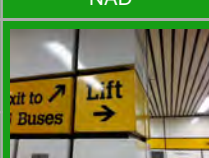
Building: Heworth Metro Station				Level: -1		Location: 006/Platform 1	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1411	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1412-1415	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1416	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1417	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1418	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1419	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1420	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1421	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1422	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station Level: -1 Location: 006/Platform 1							
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1423	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1424	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1425	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1426	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1427	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1428	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1429	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1430	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1431	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station Level: -1 Location: 006/Platform 1							
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 1432-1433	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1434	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1435-1436	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1437	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- --	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 1438-1442	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 5 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1443	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1444	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1445	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1446	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...




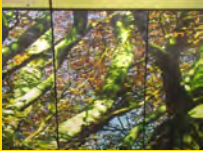



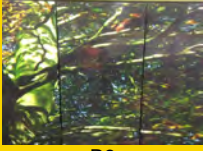
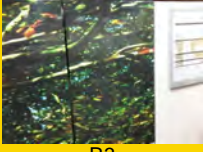
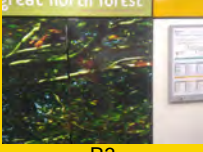


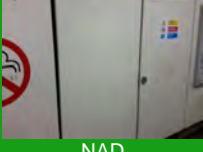



Building: Heworth Metro Station Level: -1 Location: 006/Platform 1							
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Insulating board lining to VE panel no. 1447	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1448	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1449	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1450	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1451	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 1452-1455	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1456	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1457	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 1461	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...

Building: Heworth Metro Station		Level: -1		Location: 006/Platform 1			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1462	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1463	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1464	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1465	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1466	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1467	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
PRESUME	Insulating board lining to VE panel no. 1458-1460	Insulating board	Presume Amosite	-- 8	-- 3 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1468	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1469	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1470	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1471	No asbestos identified	NAD	--	--		NAD

table continued from previous page...

Building: Heworth Metro Station			Level: -1	Location: 006/Platform 1			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1472	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1473	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1474	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1475	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1476	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1477	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1478	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1479	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
PRESUME	Insulating board lining to VE panel no. 1480	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No .	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1481	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1482	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1483	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						


table continued from previous page...

Building: Heworth Metro Station			Level: -1		Location: 006/Platform 1		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1484	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1485	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1486	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1487	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1488	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1489	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
PRESUME	Insulating board lining to VE panel no. 1490-1502	<i>Insulating board</i> Insulating board	-- Presume Amosite	-- 8	-- 13 No.	-- Reinspect Periodically	 R3
	 (<i>inspected during Survey, Survey, Management</i>)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1503	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1504	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1505	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1506	No asbestos identified	NAD	--	--		NAD
	 (inspected during Survey, Survey, Management)						
PRESUME	Insulating board lining to VE panel no. 1507-1509	<i>Insulating board</i> Insulating board	-- Presume Amosite	-- 8	-- 3 No.	-- Reinspect Periodically	 R3
	 (<i>inspected during Survey, Survey, Management</i>)  Item condition unaltered since last inspection.						

table continued from previous page...


Building: Heworth Metro Station				Level: -1 Location: 006/Platform 1			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1510	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1511	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1512	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
PRESUME	Insulating board lining to VE panel no. 1513	Insulating board	-- Presume Amosite	-- 8	--	-- Reinspect Periodically	 R3
	💬 (inspected during Survey, Survey, Management) 💬 Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1514	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1515	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1516	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1517	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1518	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1519	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1520	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1521	No asbestos identified	NAD	--	--		NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1522	No asbestos identified	NAD	--	--		NAD

table continued from previous page...

Building: Heworth Metro Station				Level: -1		Location: 006/Platform 1	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	(inspected during Survey, Survey, Management)						
	Gasket to hydrant pipe	gasket	Chrysotile	5	1 No.	Reinspect Periodically	 R3
	Item condition unaltered since last inspection.						

Building: Heworth Metro Station				Level: -1		Location: 007/Platform 2 lift shaft	
No reportable Items and Materials recorded at this Location							

Building: Heworth Metro Station				Level: -1		Location: 008/Platform 1 lift shaft	
No reportable Items and Materials recorded at this Location							

Building: Heworth Metro Station				Level: -1		Location: 009/Escalator Void	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to access hatch	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: -1		Location: 010/Lift Motor Room	
No reportable Items and Materials recorded at this Location							



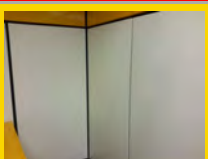
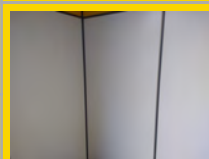

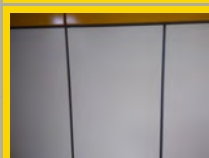
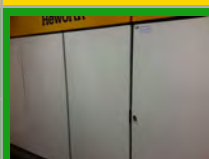
Building: Heworth Metro Station				Level: -1		Location: 011/Platform 2	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 1527-1529	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 3 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1530	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1531	Insulating board Insulating board	Amosite Amosite	9 9	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1532	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station		Level: -1		Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1533	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 1534	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1535	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1536	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1537	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 1538	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1539	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1540	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1541-1542	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...






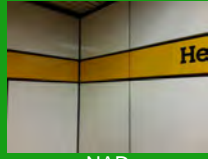




Building: Heworth Metro Station		Level: -1		Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1543	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1544	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1545	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1546	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1547	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1548	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1549	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1550	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1551	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


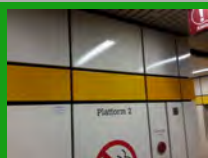
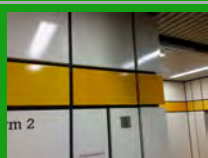
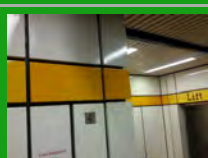




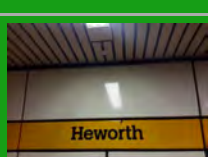

Building: Heworth Metro Station		Level: -1		Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1552	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1553	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1554	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1555	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1556	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1557	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1558	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1559	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1560	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1561	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1562	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1563	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1564	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1565	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1566	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1567	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1568	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1569	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1582	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1583	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1584	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1585-1586	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1587	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1588	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1589	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1590	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1591	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





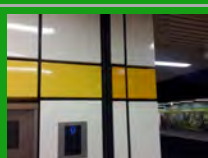




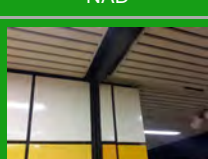
Building: Heworth Metro Station		Level: -1		Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1592	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1593	Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1594	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1595	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1596	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1597	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1598	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1599	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1600	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...













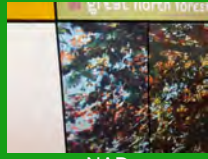
Building: Heworth Metro Station		Level: -1		Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1601	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1602	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1603	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1604	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 1605-1606	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1607	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1608	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1609-1612	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1613	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...








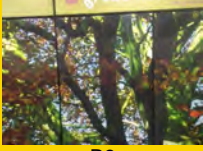

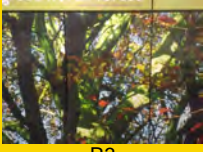

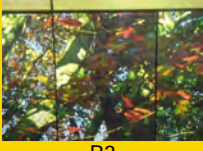


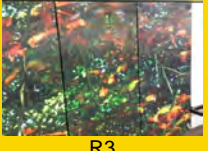



Building: Heworth Metro Station Level: -1 Location: 011/Platform 2							
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Insulating board lining to VE panel no. 1614	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	Insulating board lining to VE panel no. 1615	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	Insulating board lining to VE panel no. 1616	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	Insulating board lining to VE panel no. 1617	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	Insulating board lining to VE panel no. 1618	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 PRESUME	Insulating board lining to VE panel no. 1619	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	Insulating board lining to VE panel no. 1620	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	Insulating board lining to VE panel no. 1621	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 PRESUME	Insulating board lining to VE panel no. 1622-1627	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 6 No.	-- Reinspect Periodically	 R3
(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							

table continued from previous page...









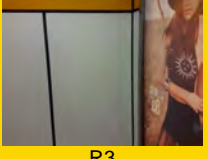



Building: Heworth Metro Station		Level: -1		Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Insulating board lining to VE panel no. 1628 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
 PRESUME	Insulating board lining to VE panel no. 1629 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	Insulating board lining to VE panel no. 1630 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 1632 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 1633 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 1570 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
 R3	Insulating board lining to VE panel no. 1571 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	Insulating board lining to VE panel no. 1572 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 1573 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD

table continued from previous page...


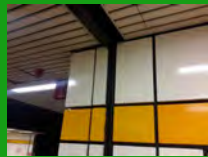


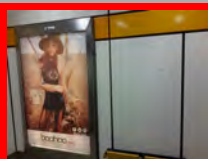





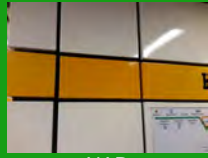
Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1574	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1575	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1576	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1577	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1578-1581	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No .	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 1631	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1634	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1635	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1636	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

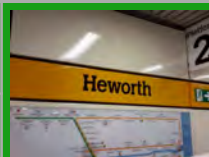



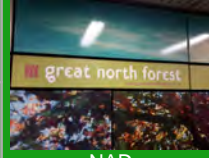
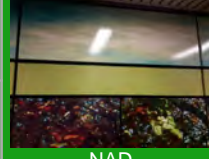

Building: Heworth Metro Station				Level: -1		Location: 011/Platform 2	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1637	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1638	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1639	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1640	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1641	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1642	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1643	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1644	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1645	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

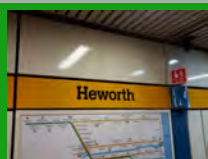
Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1646	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1647	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1648	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1649	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1650	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1651	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1652	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1653	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1654	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1655-1656	Insulating board	Presume Amosite	8	2 No.	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...




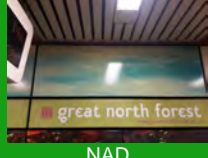
Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1657	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1658	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1659	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1660	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1661	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1662	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1663	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1664	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1665	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


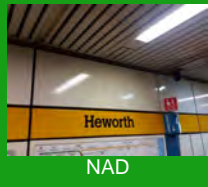





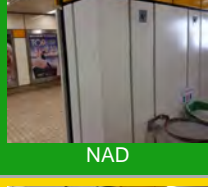


Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1666	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1667	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1668	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1669	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1670	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1671	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1672	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1673	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1674-1677	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...

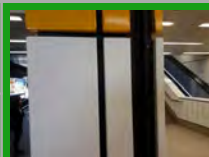



Building: Heworth Metro Station			Level: -1		Location: 011/Platform 2		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1678	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1679	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1680	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1681	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1682	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1683	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1684	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1685	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1686	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





















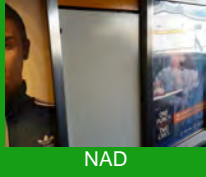

Building: Heworth Metro Station Level: -1 Location: 011/Platform 2							
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1687-1688	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						R3
	Insulating board lining to VE panel no. 1689	No asbestos identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 1690	No asbestos identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 1691	No asbestos identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 1692	No asbestos identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 1693-1694	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						R3
	Insulating board lining to VE panel no. 1695	No asbestos identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 1696	No asbestos identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 1697	No asbestos identified	NAD	--	--		
	 (inspected during Survey, Survey, Management)						NAD

table continued from previous page...




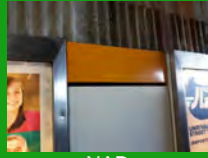

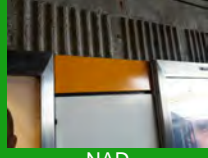




Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1698	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1699	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1700	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1701	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1702	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1703	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1704-1713	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 10 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1714	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1715	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


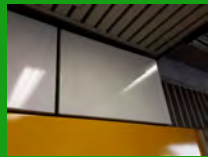
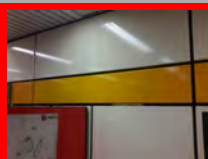





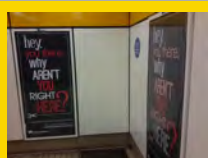


Building: Heworth Metro Station			Level: -1	Location: 011/Platform 2			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1716	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1717	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
Building: Heworth Metro Station			Level: -1	Location: 012/Platform 2 Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 532	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 533	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 534	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 535-538	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 539	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 540	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 541	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station Level: -1 Location: 012/Platform 2 Concourse							
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 542	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 543	Insulating board	Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 544	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 545	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 546	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 547-549	Insulating board	Presume Amosite	-- 8	-- 3 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 550	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 551	Insulating board	Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 552	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...












Building: Heworth Metro Station			Level: -1	Location: 012/Platform 2 Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 553	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 554	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 555	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 556	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 557	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 558	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 559	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 560	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 561	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





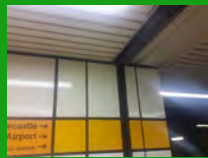




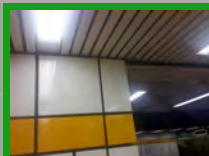
Building: Heworth Metro Station			Level: -1	Location: 012/Platform 2 Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 562	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 563	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 567	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 564-566	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 3 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 568	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 569	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 570	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 571	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 572	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...

Building: Heworth Metro Station			Level: -1	Location: 012/Platform 2 Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 573	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 574	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 575	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 576	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 577	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 578	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 579	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 580	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 581	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station				Level: -1		Location: 012/Platform 2 Concourse		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Insulating board lining to VE panel no. 582	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							


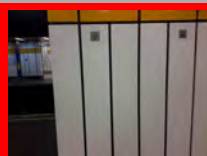

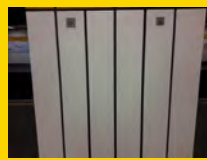







Building: Heworth Metro Station				Level: -1		Location: 013/Platform 1 Concourse West		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Insulating board lining to VE panel no. 901	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
 PRESUME	Insulating board lining to VE panel no. 902	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3	
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 R3	Insulating board lining to VE panel no. 903	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 9	-- 1 No.	-- Reinspect Periodically	 R3	
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
 PRESUME	Insulating board lining to VE panel no. 904	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3	
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.							
	Insulating board lining to VE panel no. 905	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 906	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 907	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 908	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Heworth Metro Station			Level: -1	Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 909	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 910	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 911	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 912	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 913	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 914	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 915	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 916	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 917	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


Building: Heworth Metro Station			Level: -1	Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 918	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 919	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 920	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 921	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 922	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 923	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 924	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 925	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 926	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...








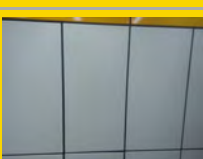
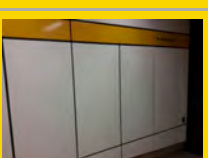
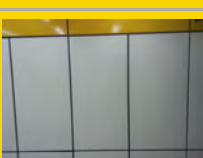
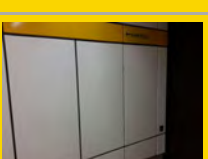
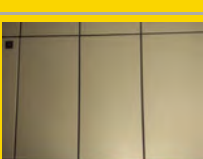
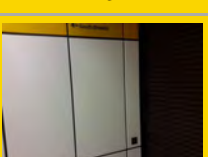
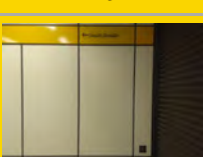
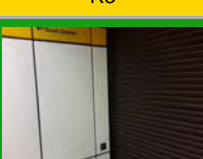
Building: Heworth Metro Station		Level: -1		Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 927	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 928	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 929	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 930	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 931	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 932	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 933	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 934	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 935	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

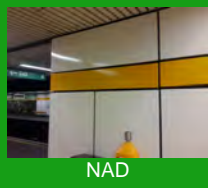


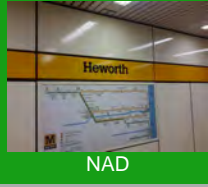




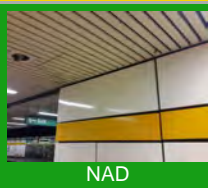
Building: Heworth Metro Station			Level: -1	Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 936	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 937	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 938	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 939	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 940	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 941	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 942	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 943	Insulating board	Chrysotile, Amosite, Chrysotile, Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 944	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...













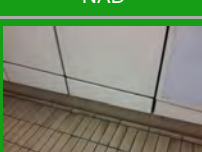

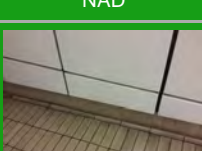

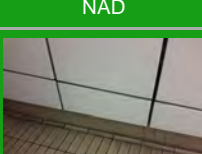

Building: Heworth Metro Station			Level: -1		Location: 013/Platform 1 Concourse West		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 945-947	<i>Insulating board</i> Insulating board	-- Presume Amosite	-- 8	-- 3 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 948	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 950	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 949	<i>Insulating board</i> Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 951	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 952	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 953	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 954	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 955	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...









Building: Heworth Metro Station		Level: -1		Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 956	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 957	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 958	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 959	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 960	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 961	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 962-963	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 964	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 965-966	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...



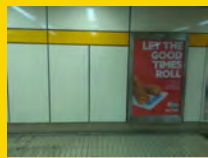




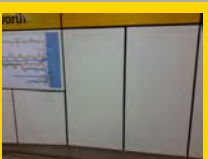







Building: Heworth Metro Station		Level: -1		Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 967	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 968	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 969	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 970	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	9 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 971	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	9 9	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 972	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 973	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 974	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 975	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...













Building: Heworth Metro Station		Level: -1		Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 976	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 977	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item identified on pre-refurbishment survey [187869]. Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 978	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 979	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 980	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 981	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 982	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 983	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 984	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...
















Building: Heworth Metro Station			Level: -1	Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 985	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 986	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 987	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 988	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 989	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 990	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 991	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 992	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 993	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station				Level: -1				Location: 013/Platform 1 Concourse West			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record				
	Insulating board lining to VE panel no. 994	No asbestos identified	NAD	--	--		 NAD				
	 (inspected during Survey, Survey, Management)										
	Insulating board lining to VE panel no. 1005	No asbestos identified	NAD	--	--		 NAD				
	 (inspected during Survey, Survey, Management)										
	Insulating board lining to VE panel no. 1006	No asbestos identified	NAD	--	--		 NAD				
	 (inspected during Survey, Survey, Management)										
 PRESUME	Insulating board lining to VE panel no. 995-1004	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 10 No	-- Reinspect Periodically	 R3				
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.										

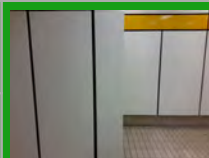

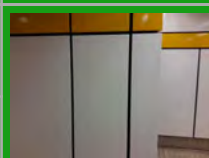






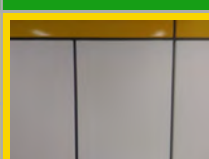


Building: Heworth Metro Station				Level: -1				Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record				
	Insulating board lining to VE panel no. 1333	No asbestos identified	NAD	--	--		 NAD				
	 (inspected during Survey, Survey, Management)										
	Insulating board lining to VE panel no. 1334	No asbestos identified	NAD	--	--		 NAD				
	 (inspected during Survey, Survey, Management)										
 PRESUME	Insulating board lining to VE panel no. 1325-1330	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 6 No.	-- Reinspect Periodically	 R3				
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.										
	Insulating board lining to VE panel no. 1332	No asbestos identified	NAD	--	--		NAD				
 R3	Insulating board lining to VE panel no. 1335	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3				
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.										

table continued from previous page...




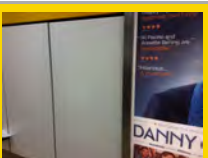


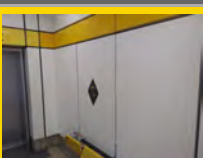

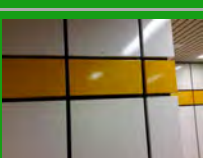
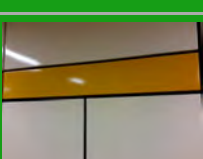
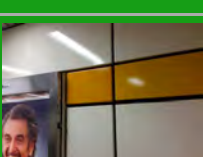

Building: Heworth Metro Station		Level: -1		Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Insulating board lining to VE panel no. 1336	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1337	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 1338	Insulating board Insulating board	Amosite Amosite	9 --	-- 1 No.	-- --	 ERROR
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1339-1341	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 3 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1342	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1343	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1344	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1345	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1346	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: -1	Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1347	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1348	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1349	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1350-1353	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1354	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1355	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1356	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1357	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1358	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





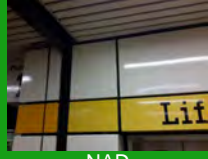



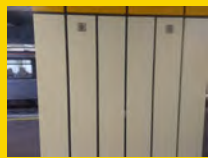


Building: Heworth Metro Station			Level: -1	Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1360	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1361	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1362	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1363	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1364	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1375	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1376	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 1377	Insulating board	Amosite	9	--	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1378	Insulating board	Amosite	9	--	Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...




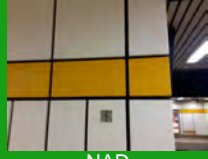


Building: Heworth Metro Station			Level: -1	Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1365	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1366	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1367	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1368	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1369	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1370	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1371	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1372	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1373	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



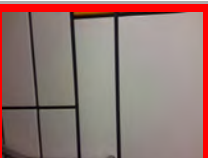

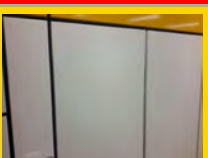



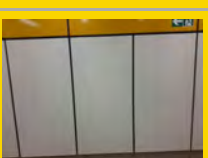



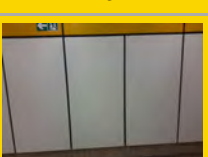
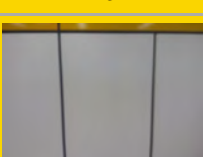

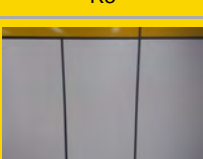
Building: Heworth Metro Station		Level: -1		Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 1359 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	Insulating board lining to VE panel no. 1374 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
 PRESUME	Insulating board lining to VE panel no. 1299 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
 R3	Insulating board lining to VE panel no. 1300 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
 R3	Insulating board lining to VE panel no. 1301 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
 R3	Insulating board lining to VE panel no. 1302 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
 R3	Insulating board lining to VE panel no. 1303 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	9 9	-- 1 No.	-- Reinspect Periodically	 R3
 R3	Insulating board lining to VE panel no. 1304 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
 R3	Insulating board lining to VE panel no. 1305 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3

table continued from previous page...


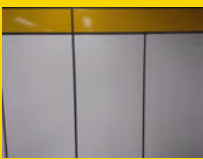
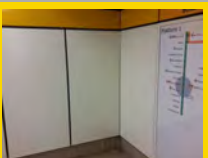

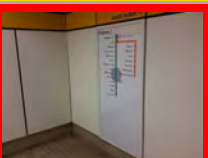




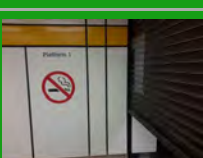
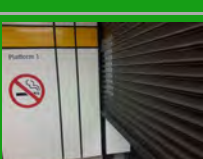

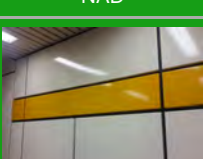
Building: Heworth Metro Station		Level: -1		Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Insulating board lining to VE panel no. 1306	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1307	Insulating board Insulating board	Amosite Amosite	9 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 1308-1309	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 1310	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1311	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1312	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1313	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1314	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1315	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: -1	Location: 014/Platform 1 Concourse East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1316	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1317	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1318	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1319	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1320	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1321	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1322	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1323	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1324	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station				Level: -1		Location: 014/Platform 1 Concourse East	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1331	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: 0		Location: 001/Concourse	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 001	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 002	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 003	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 004	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 005	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 006	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 007	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 008	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...

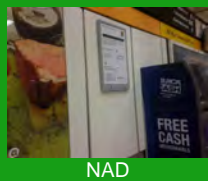











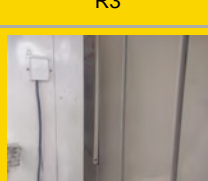
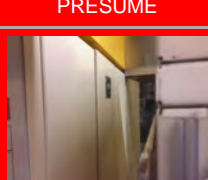
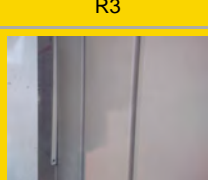
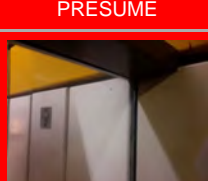
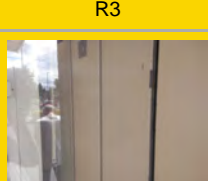
Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 013	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 014	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 019	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 020	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 025	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 026	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 027	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 028	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 029	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...



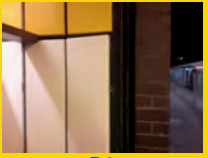
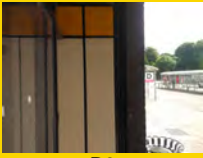

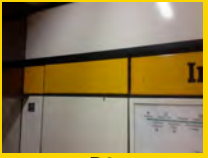






Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 030	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	
PRESUME	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						R3
	Insulating board lining to VE panel no. 031	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	
R3	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						R3
	Insulating board lining to VE panel no. 032	No asbestos identified	NAD	--	--		
	(inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 034	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 8	-- 1 No	-- Reinspect Periodically	
R3	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						R3
	Insulating board lining to VE panel no. 036	No asbestos identified	NAD	--	--		
	(inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 035	No asbestos identified	NAD	--	--		
	(inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 037	No asbestos identified	NAD	--	--		
	(inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 038	No asbestos identified	NAD	--	--		
	(inspected during Survey, Survey, Management)						NAD
	Insulating board lining to VE panel no. 039	No asbestos identified	NAD	--	--		
	(inspected during Survey, Survey, Management)						NAD

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 040	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 041	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 042	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 043	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 044	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 045	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 046	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 047	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 048	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 050	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 051	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 052	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 049	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 055	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 056	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 053	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 054	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 057	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...













Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 058	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 059	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 060	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 061	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 062	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 063	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 064	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 065	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 066	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...














Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 067	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 068	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 069	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 070	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	8 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 071	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 072	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 073	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 074	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 075	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





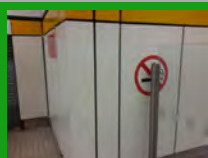
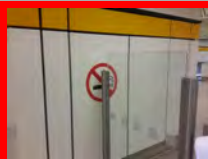





Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 076	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 077	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 078	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 079	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 080	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 081	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 082	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 083	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 084	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 085	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 086	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 087	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 088	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 089	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 096	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 097	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 098	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 099	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

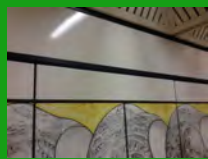
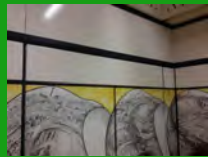

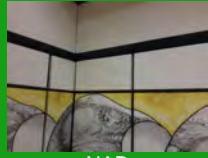
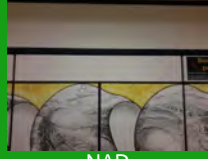
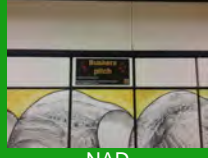


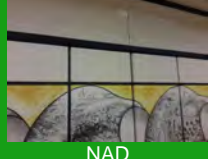
Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 100	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 101	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 102	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 115	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 116	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 117	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 118	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 119	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 120	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...






Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 121	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 122	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 123	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 124	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 125	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 126	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 127	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 128	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 129	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

















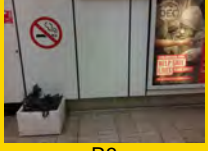


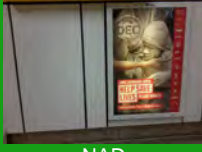

Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 130	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 132	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 133	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 134	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 135	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 131	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 136	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 137	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	8 --	-- 1 No.	-- Reinspect Periodically	 ERROR
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 138	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...


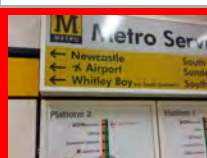
Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 139	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 140	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 141	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 142	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 143	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 144	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 145	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 146	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 147	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...



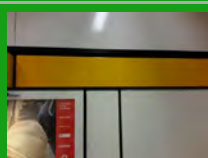





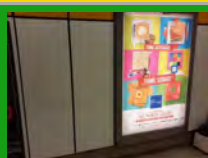
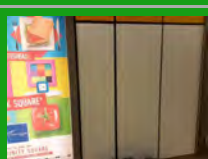
Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 148	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 149	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 150	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 151	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 152	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 153	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 154	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 155	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 156	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...








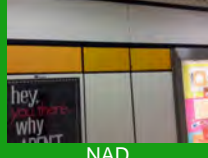

Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 157	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 158	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 159	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 160	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 161	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 162	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 163	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 164	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 165	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 166	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 167	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 168	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 169	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 170	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 171	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 172	Insulating board Insulating board	-- Presume Chrysotile	-- 7	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 173	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 174	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...












Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 175	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 176	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 177	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 178	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 179	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 180	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 181	Insulating board Insulating board	Chrysotile, Amosite Chrysotile, Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 182	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 184	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



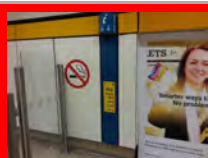


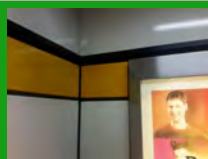
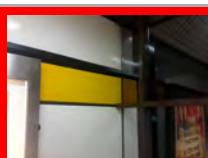

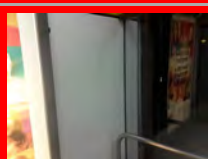
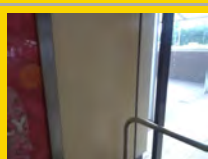

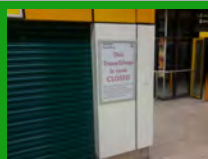
Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 188	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 189	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 183	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Redundant insulating board panel	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 211	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 212-213	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 209-210	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 185	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 186	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...






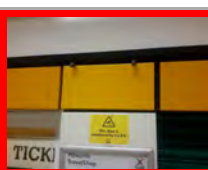
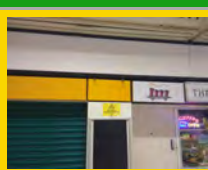



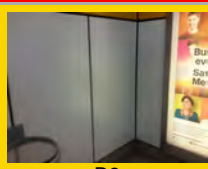
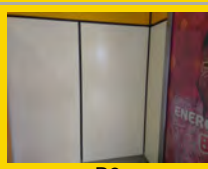


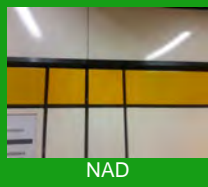
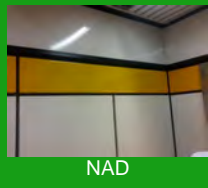
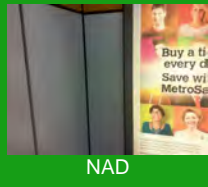


Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 187	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 190	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 191	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 196	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 193	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 197	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 198-202	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 5 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 203	Insulating board Insulating board	Amosite Amosite	8 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 204-205	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						




table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 001/Concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 206	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 207	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 208	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 033	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

Building: Heworth Metro Station **Level: 0** **Location: 001/LV room - DUPLICATE LOCATION**

No reportable Items and Materials recorded at this Location





Building: Heworth Metro Station **Level: 0** **Location: 002/Newsagent**


First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Whole location	No Access Gained	--	--	--		
	 Limited Access:  (inspected during Survey, Survey, Management)						


Building: Heworth Metro Station **Level: 0** **Location: 002/Switch room -DUPLICATE LOCATION**

No reportable Items and Materials recorded at this Location

Building: Heworth Metro Station **Level: 0** **Location: 003/Cleaners Cupboard**

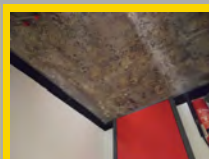


First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Brown floor tiles	Vinyl floor tiles Vinyl floor tiles	Chrysotile Chrysotile	3 3	-- 1 Sqm.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						

Building: Heworth Metro Station			Level: 0	Location: 003/Relay room - DUPLICATE LOCATION			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Debris to floor void	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Beige floor tiles	Composites	Chrysotile	2	--	--	 R3
	 (inspected during Survey, Survey, Management)						

Building: Heworth Metro Station			Level: 0	Location: 004/Control Room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Brown floor tiles	Vinyl floor tiles Vinyl floor tiles - removed	Chrysotile --	3 --	-- --	--	 REMOVED
 (inspected during Survey, Survey, Management)  Item has been removed since last inspection [187869].							

Building: Heworth Metro Station			Level: 0	Location: 004/Escalator / Emergency exit			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Panel to emergency hatch	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

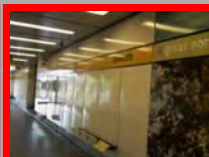



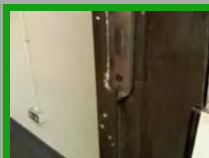

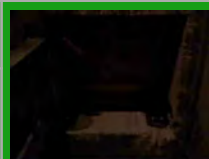

Building: Heworth Metro Station			Level: 0	Location: 005/Lift machine room - DUPLICATE LOCATION			
No reportable Items and Materials recorded at this Location							

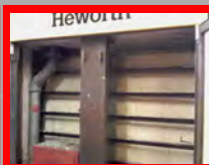
Building: Heworth Metro Station			Level: 0	Location: 005/Lobby			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Bitumen floor adhesive	Bitumen products Bitumen products	Chrysotile Chrysotile	4 4	-- 4 Sqm.	-- Remove	 R3
 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							




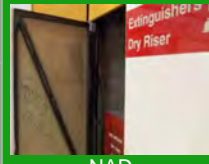
Building: Heworth Metro Station			Level: 0	Location: 006/Office			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Brown vinyl floor tiles	vinyl tile	--	--	--		REMOVED
	 Item has been removed since last inspection [187869].						

Building: Heworth Metro Station			Level: 0	Location: 006/Station platform - DUPLICATE LOCATION			
				 Refer to -1/011 Platform 2			

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 006/Station platform - DUPLICATE LOCATION			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
	 (inspected during Survey, Survey, Management)						
	Dust within platform canopy	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
Building: Heworth Metro Station			Level: 0	Location: 007/Staff Room			
No reportable Items and Materials recorded at this Location							
Building: Heworth Metro Station			Level: 0	Location: 008/Kitchen			
No reportable Items and Materials recorded at this Location							
Building: Heworth Metro Station			Level: 0	Location: 009/Elevator and emergency exit - DUPLICATE LOCATION			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Door panel	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Emergency exit hatch	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
Building: Heworth Metro Station			Level: 0	Location: 009/Lobby			
No reportable Items and Materials recorded at this Location							
Building: Heworth Metro Station			Level: 0	Location: 010/Lift machine room - DUPLICATE LOCATION			
No reportable Items and Materials recorded at this Location							
Building: Heworth Metro Station			Level: 0	Location: 010/Male WC			
No reportable Items and Materials recorded at this Location							
Building: Heworth Metro Station			Level: 0	Location: 011/Female WC			
No reportable Items and Materials recorded at this Location							

Building: Heworth Metro Station			Level: 0	Location: 011/Station platform - DUPLICATE LOCATION			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Rear panel to extinguisher dry riser	Asbestos Insulating Board	Amosite	7	--	--	 R1
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station			Level: 0	Location: 011/Station platform - DUPLICATE LOCATION			
		(inspected during Survey, Survey, Management)					
		Refer to -1/006 Platform 1					
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Gasket to hydrant line	Ropes, Cloths & Yarns	Chrysotile	6	--	--	 R3
	(inspected during Survey, Survey, Management)						
	Residue to canopy	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
	(inspected during Survey, Survey, Management)						
	Internal panel to extinguisher dry riser	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station			Level: 0	Location: 012/Travelshop			
No reportable Items and Materials recorded at this Location							

Building: Heworth Metro Station			Level: 0	Location: 013/Transformer building			
No reportable Items and Materials recorded at this Location							


Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 224	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

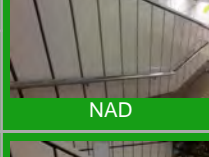
Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 225	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 226	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 227	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 228	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 229	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 230	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 231	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 232	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 233	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

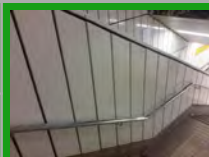

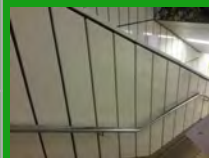











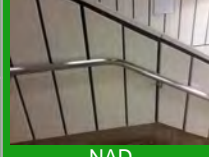



Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 234	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 235	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 236	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 237	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 238	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 239	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 240	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 241	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 242	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...




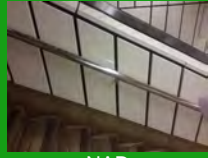

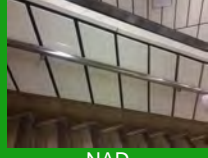

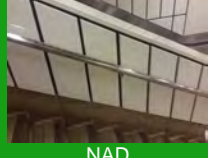
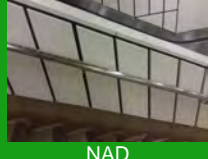
Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 243	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 244	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 245	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 246	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 247	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 248	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 249	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 250	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 251	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





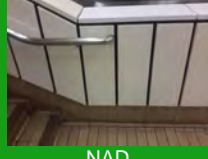


Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 252	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 253	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 254	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 255	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 256	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 257	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 258	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 259	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 260	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



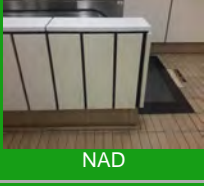


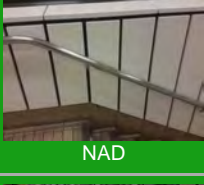

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 261	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 262	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 263	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 264	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 265	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 266	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 267	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 223	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 268	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




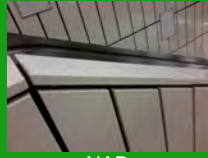





Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 269	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 270	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 271	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 272	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 273	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 274	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 275	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 276	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 277	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...










Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 278	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 279	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 280	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 281	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 282	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 283	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 284	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 285	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 286	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


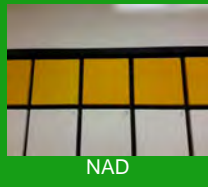
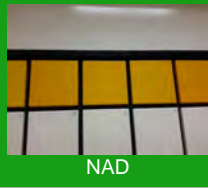
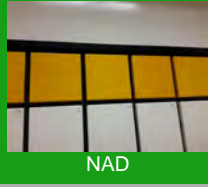
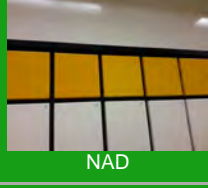
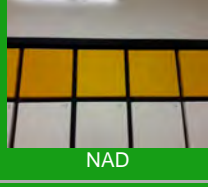
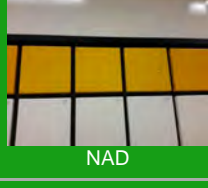


Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 287	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 288	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 289	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 290	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 291	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 292	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 293	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 294	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 295	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 296	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



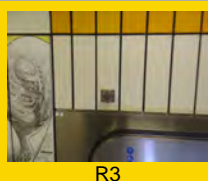
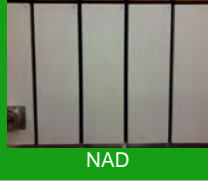
Building: Heworth Metro Station		Level: 0		Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 297	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 298-315	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 18 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 316	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 317	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 318	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 319	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 320	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 321	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 322	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




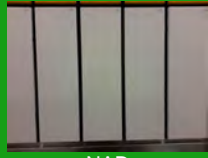



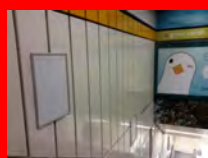
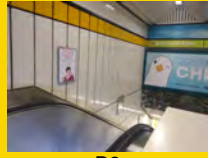

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 323	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 324	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 325	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 326	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 327	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 328	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 329	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 330-346	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 17 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 347	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





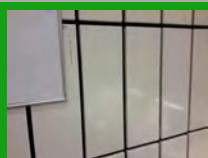
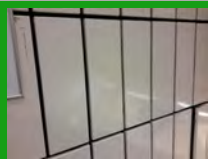


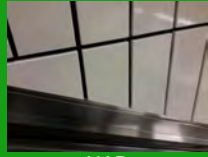
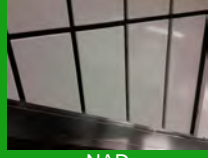
Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 348	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 349	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 350-351	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 352	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 353	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 354	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 358	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 359	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 360	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

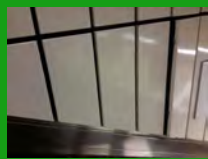

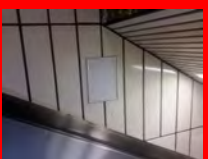
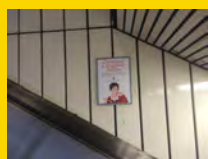
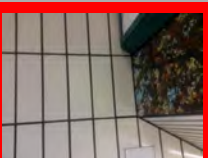
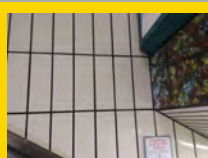
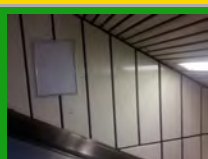
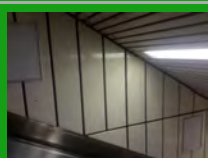
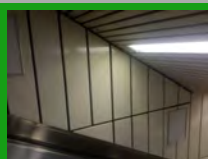
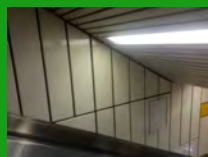
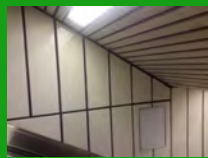
Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 361	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 363	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 364, 366	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 355-357, 365	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 367	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 368	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 369	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 370	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 371	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


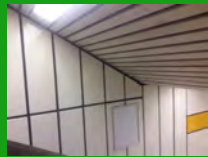


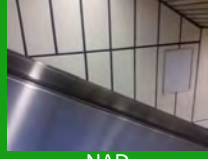



Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 372	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 373	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 374	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 375	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 376	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 377	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 378	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 379-380	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 381	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




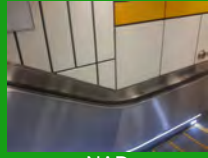

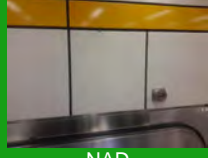



Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 382	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 383	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 384	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 385	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 386	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 387	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 388	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 389	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 390	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


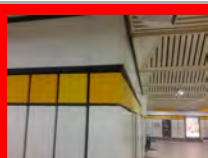
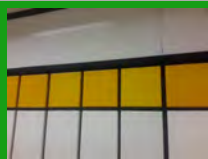


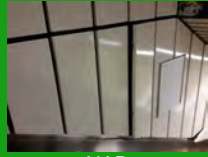

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 391	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 392	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 393	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 394	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 395	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 396	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 397	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 362	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 398	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

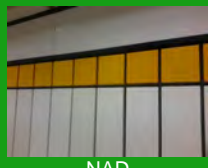

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 399	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 400	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 401	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 402-423	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 22 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 424	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 425	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 426	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 427	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 428	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




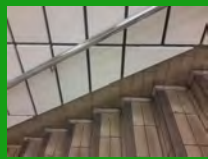
Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 429	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 430	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 431	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 432	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 433	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 434	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 435-454	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 20 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 455	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 456	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





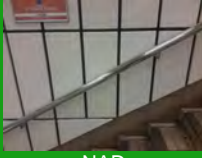



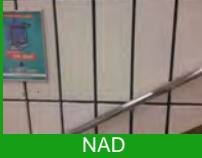

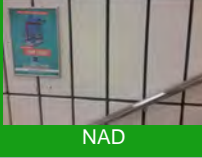







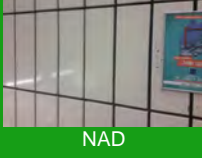



Building: Heworth Metro Station			Level: 0		Location: 014/Platform 2 Stairwell		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 457-458	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 459	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 460	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 461	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 462	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 463-464	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 465	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 466	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 467	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

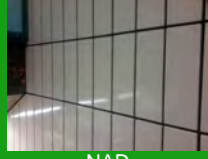

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 468	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 469	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 470	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 471	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 472	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 473	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 477	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 478	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 479	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




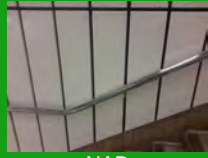
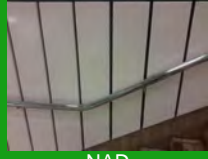



Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 480	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 481	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 482	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 483	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 484	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 485	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 486	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 487	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 488	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 490	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 491	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 492	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 493	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 494	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 495	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 496	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 499	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 497-498	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 500	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 489	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 501	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 502	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 503	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 504	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 505	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 506	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 507	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



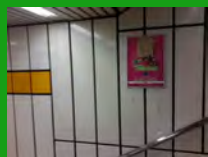
Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 508	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 509	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 510	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 511	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 512-513	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 514	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 474-476	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 3 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 515	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 516	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 517	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 518	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 519	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 520	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 521	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 522	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 523	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 524	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 525	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...










Building: Heworth Metro Station		Level: 0		Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	Insulating board lining to VE panel no. 526 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 8	-- 1 No	-- Reinspect Periodically	 R3
 R3	Insulating board lining to VE panel no. 527 (inspected during Survey, Survey, Management) Item condition unaltered since last inspection.	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 9	-- 1 No	-- Reinspect Periodically	 R3
	Insulating board lining to VE panel no. 528 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 529 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 530 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 531 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 214 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 215 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD
	Insulating board lining to VE panel no. 216 (inspected during Survey, Survey, Management)	No asbestos identified	NAD	--	--		 NAD

table continued from previous page...

Building: Heworth Metro Station				Level: 0	Location: 014/Platform 2 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Insulating board lining to VE panel no. 217	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 218	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 219	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 220	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 221	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 222	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

Building: Heworth Metro Station				Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Insulating board lining to VE panel no. 583	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 584	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board lining to VE panel no. 585	No asbestos identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

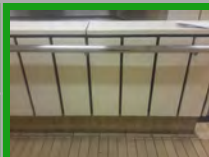



Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 586	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 587	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 588	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 589	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 590	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 591	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 592	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 593	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 594	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

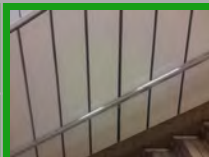

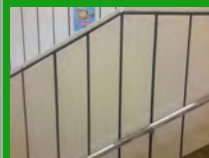



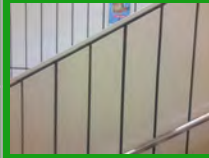

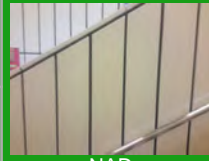



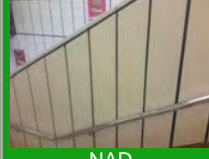

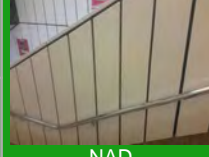

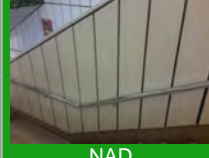

Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 595	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 596	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 597	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 598	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 599	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 600	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 601	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 602	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 603	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

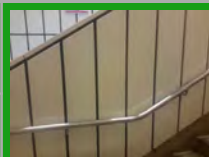
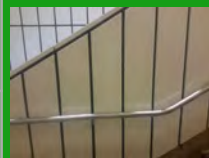





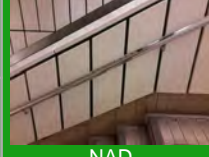

Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 604	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 605	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 606	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 607	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 608	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 609	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 612	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 613	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 614	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 615	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 616	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 617	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 618	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 619	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 620	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 621	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 622	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 623	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 624	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 625	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 626	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 627	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 628	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 629	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 630	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 631	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 632	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						

table continued from previous page...










Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 633	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 634	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 635	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 636	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 637	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 638	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 639	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 640	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 641	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...






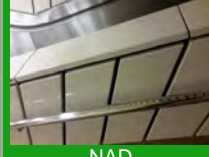

Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 642	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 643	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 644	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 645	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 646	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 647	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 648	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 649	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 650	No asbestos identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						

table continued from previous page...


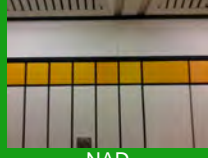
Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 651	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 652	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 653	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 610	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 654	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 655	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 656	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 657	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 658	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


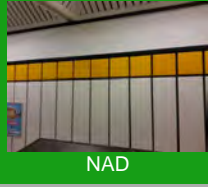




Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 659	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 660	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 661	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 662	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 663	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 664	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 665	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 667-684	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 18 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 666	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 685	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 686	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 687	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 688	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 689	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 690	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 691	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 692	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 693	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...





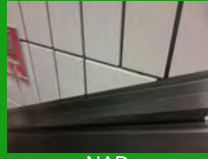

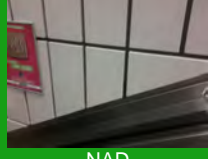
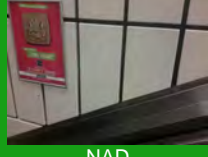
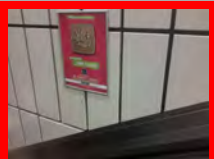
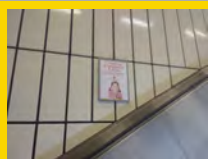
Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 694	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 695	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 696	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 697	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 716	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 700	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 717	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 718	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 719-720	Insulating board	-- Presume Amosite	-- 8	-- 2 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...




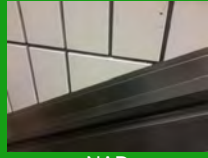
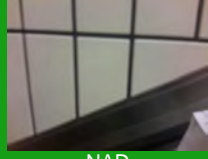
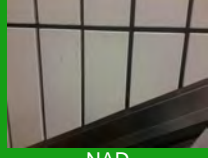
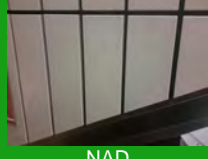
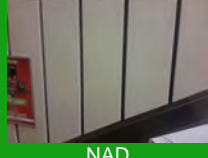
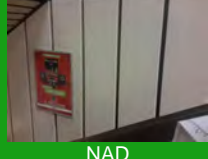
Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 721	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 722	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 723	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 728	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 729	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 730	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 731	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 732	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 733	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

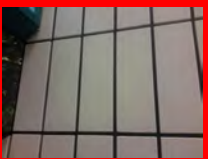

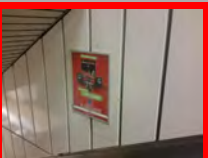
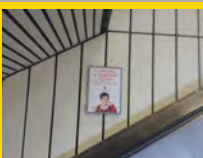
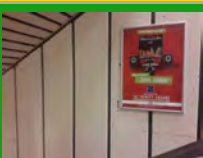
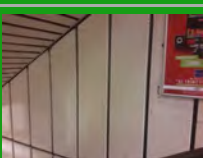
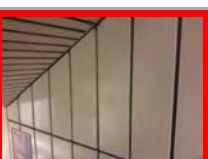
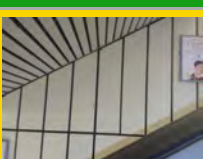
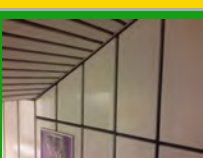
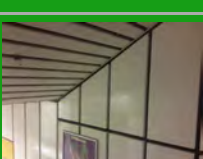
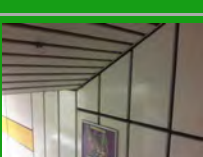

Building: Heworth Metro Station Level: 0 Location: 015/Platform 1 Stairwell							
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 724-727	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 4 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 734-735	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 736	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 737	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 738-740	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 3 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 741	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 742	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 743	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 744	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

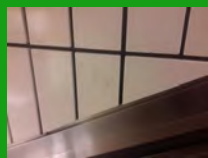



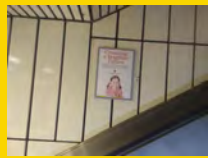






Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 745	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 746	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 747	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 748-749	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 750	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 751	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 752	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 753	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 754	No asbestos identified	NAD	--	--		NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 755	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



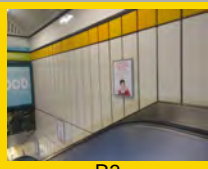






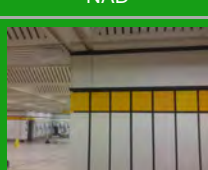
Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 756	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 698-699	Insulating board	Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 757	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 758	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 759	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 760	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 761	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 762	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 763	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




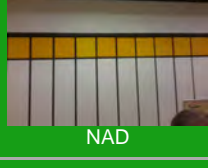
Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 764	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 765	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 766	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 767	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 768	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 769	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 770-792	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 23 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 793	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 794	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

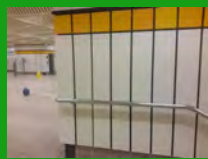


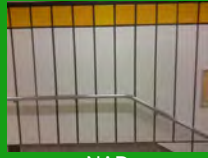

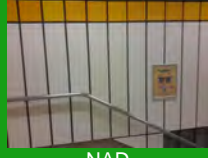




Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 795	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 796	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 797	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 798	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 799	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 800	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 801	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 802	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 701-715	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 15 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...

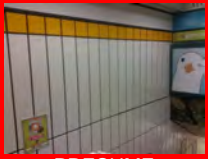
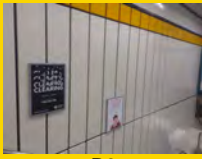

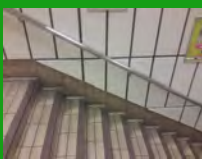
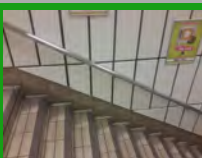
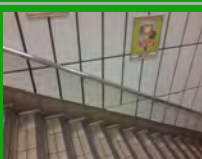
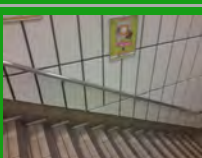
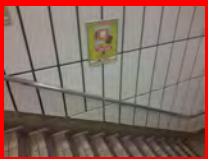

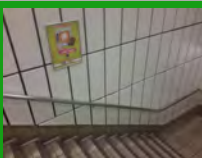
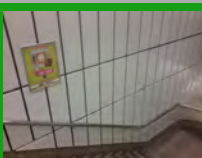
Building: Heworth Metro Station			Level: 0		Location: 015/Platform 1 Stairwell		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 803-823	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 21 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 824	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 825	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 826	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 827	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 828	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 829-830	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 831	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 832	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

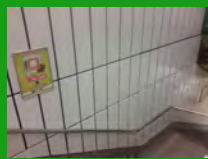


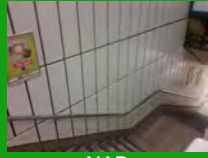
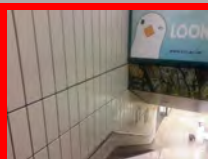

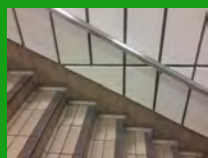



Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 833	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 834	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 835	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 836	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 837-845	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 9 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 846	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 847	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 848	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 849	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




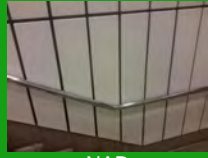


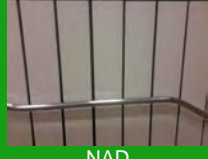


Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 850	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 851	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 852	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 853	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 854	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 855	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 856	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 857	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 858	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




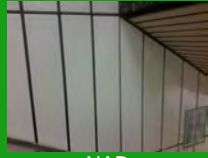
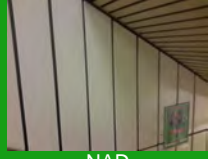

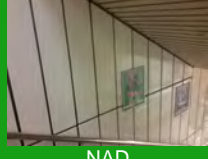

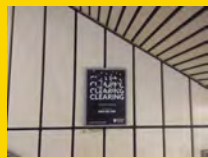

Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 859	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 860	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 861	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 862	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 863	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 864	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 865	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 866-867	Insulating board	-- Presume Amosite	-- 8	-- 2 No.s	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 868	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 869	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 870	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 871	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 872	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 873	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 874	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 875	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 876	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 877-878	Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

table continued from previous page...




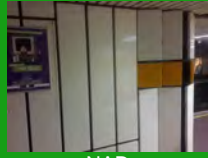

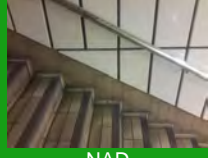



Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 879	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 880	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 883	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 884	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 885	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 886	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 887	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 888	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 889	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...


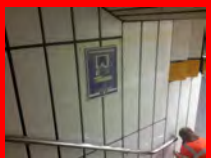








Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 890	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 881-882	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 2 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 891	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 892	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 R3	Insulating board lining to VE panel no. 893	Insulating board Insulating board	Amosite, Chrysotile Amosite, Chrysotile	9 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 894	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 895	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 896	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 897	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




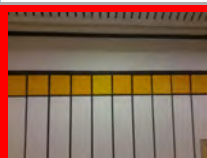

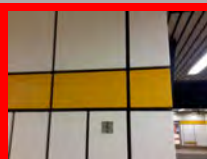
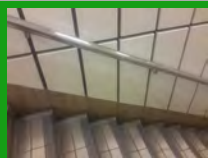



Building: Heworth Metro Station			Level: 0	Location: 015/Platform 1 Stairwell			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 898	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 899	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 900	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 611	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 1141	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1071	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1072	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1073	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1074	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



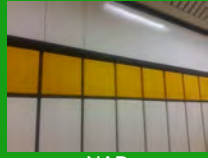




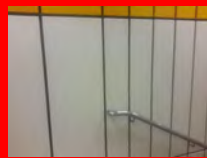

Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1075	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1076	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1007	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1008	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1009	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1010	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1011-1037	Insulating board	-- Presume Amosite	-- 8	-- 27 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
 PRESUME	Insulating board lining to VE panel no. 1038	Insulating board	-- Presume Amosite	-- 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1039	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1040	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1041	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1042	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1043	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1044	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1045-1068	Insulating board	-- Presume Amosite	-- 8	-- 24 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1069	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1070	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1077	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...



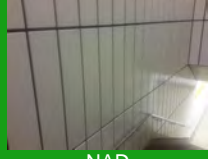




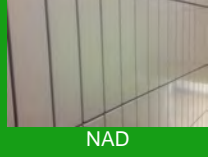
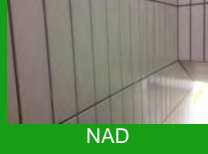
Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1078	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1079	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1080	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1081	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1082	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1083	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1084	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1085	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1086	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

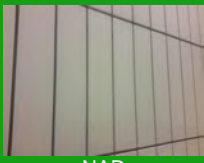

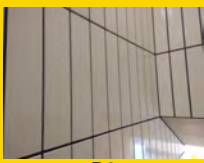

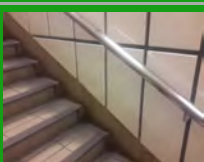



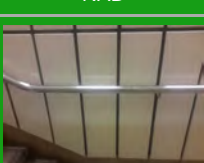
Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1087	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1088-1095	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 8 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1096	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1097	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1098	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1099	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1100	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1101	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1102	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




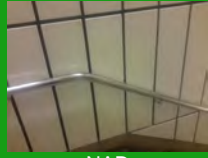
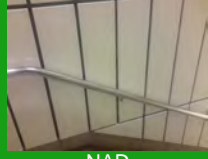
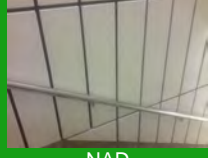

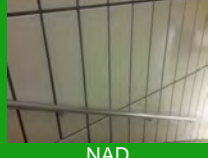
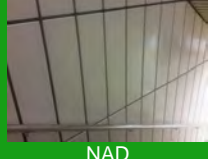
Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1103	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1104	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1105	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1106	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1107	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1108	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1109	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1110	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1111	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




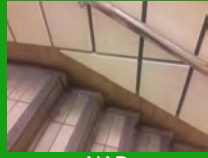
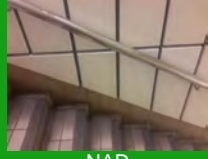
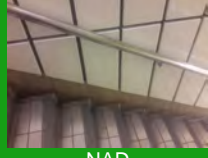
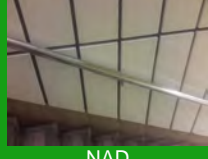


Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1112	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1113	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1114	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1121	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1122	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1123	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1124	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1125	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1126	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1127	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1128	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1129	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1130	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1131	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1132	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1133	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1134	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1135	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




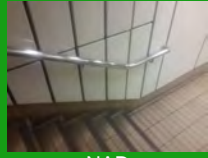
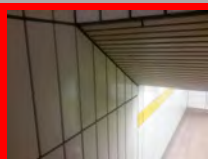
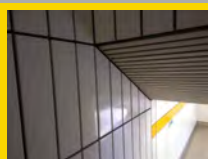





Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1136	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1137	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1138	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1139	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1115-1120	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 6 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1140	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 1142	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item identified on pre-refurbishment survey [187869]. Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1143	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1144	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




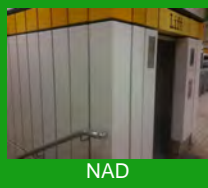



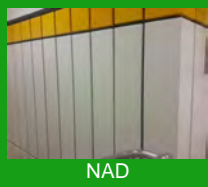
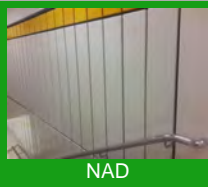


Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1145	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1146-1172	Insulating board Insulating board	-- Presume Amosite	-- 8	-- 27 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1173	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 R3	Insulating board lining to VE panel no. 1174	Insulating board Insulating board	Amosite Amosite	9 8	-- 1 No	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1175	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1176	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1177	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1178	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1179	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

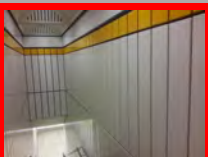



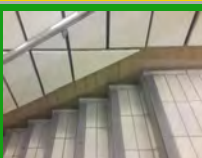

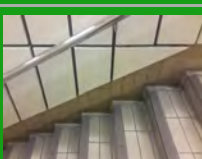

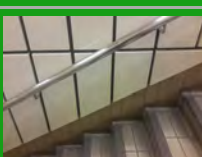

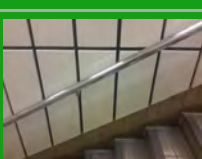



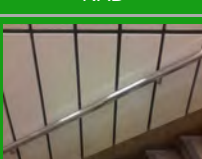

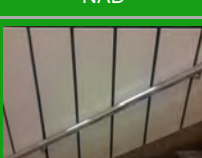

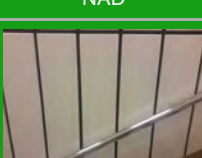

Building: Heworth Metro Station			Level: 0		Location: 016/Platform 1 Stairwell East		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 PRESUME	Insulating board lining to VE panel no. 1180-1203	<i>Insulating board</i> Insulating board	-- Presume Amosite	-- 8	-- 24 No.	-- Reinspect Periodically	 R3
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1204	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1205	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1206	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1207	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1208	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1209	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1210	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1211	No asbestos identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...


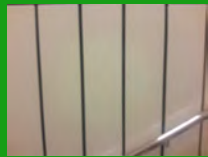

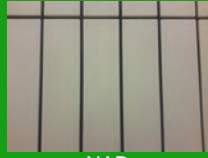



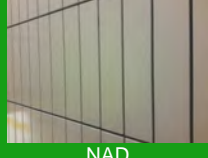
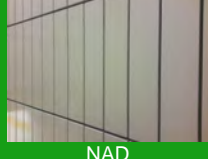
Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1212	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1213	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1214	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1215	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1216	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1217	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1218	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1219	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1220	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...











Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1221	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1222	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1223	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1224-1231	Insulating board	-- Presume Amosite	-- 8	-- 8 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						
	Insulating board lining to VE panel no. 1232	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1233	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1234	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1235	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1236	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1237	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1238	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1239	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1240	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1241	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1242	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1243	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1244	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1245	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1246	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1247	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1248	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1249	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1250	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1258	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1259	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1260	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1261	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...




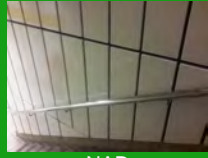


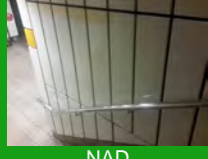










Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1262	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1263	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1264	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1265	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1266	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1267	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1268	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1269	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1270	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						


table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1271	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1272	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1273	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1274	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1275	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1276	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1277	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1278	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
 PRESUME	Insulating board lining to VE panel no. 1251-1257	Insulating board	-- Presume Amosite	-- 8	-- 7 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management)						
	Item condition unaltered since last inspection.						

table continued from previous page...

Building: Heworth Metro Station			Level: 0	Location: 016/Platform 1 Stairwell East			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board lining to VE panel no. 1279	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1280	No asbestos identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board lining to VE panel no. 1281-1298	Insulating board	-- Presume Amosite	8	-- 18 No.	-- Reinspect Periodically	 R3
	(inspected during Survey, Survey, Management) Item condition unaltered since last inspection.						

Building: Heworth Metro Station			Level: 1	Location: 001/Ticket concourse - DUPLICATE LOCATION			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Internal door panel to fire alarm	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Internal panel to extinguisher dry riser	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Internal soffit panel to fire extinguisher point	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station			Level: 1	Location: 003/Cleaners cupboard - DUPLICATE LOCATION			
				Refer to 0/003 Cleaners Cupboard			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Brown floor tile	Composites	Chrysotile	3	--	--	 R3
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: 1	Location: 004/Control room - DUPLICATE LOCATION		
					Refer to 0/004 Control Room		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Brown floor tile	Composites	Chrysotile	3	--	--	 R3
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: 1	Location: 005/Staff lobby - DUPLICATE LOCATION		
					Refer to 0/005 Staff lobby		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Brown & White floor tile	Composites	Chrysotile	4	--	--	 R3
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: 1	Location: 006/Controllers office - DUPLICATE LOCATION		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Brown floor tile	Composites	Chrysotile	2	--	--	 R3
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: 1	Location: 007/Staff restroom - DUPLICATED LOCATION		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Brown floor tiles	Composites	Chrysotile	2	--	--	 R3
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: 1	Location: 008/Staff kitchen - DUPLICATE LOCATION		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Sink pad	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

Building: Heworth Metro Station				Level: 1	Location: 009/Lobby area - DUPLICATE LOCATION		
No reportable Items and Materials recorded at this Location							

Building: Heworth Metro Station				Level: 1	Location: 010/Gents toilet - DUPLICATE LOCATION		
No reportable Items and Materials recorded at this Location							

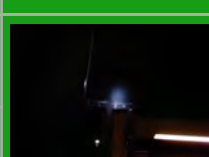
Building: Heworth Metro Station			Level: 1	Location: 011/Ladies toilet - DUPLICATE LOCATION				
No reportable Items and Materials recorded at this Location								
Building: Heworth Metro Station			Level: 99	Location: 001/External Canopy				
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Insulating board to rear of v.e panel 001	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 002	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 003	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 004	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 005	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 006	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 007	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 008	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 009	No Asbestos Identified	NAD	--	--		 NAD	
	💬 (inspected during Survey, Survey, Management)							

table continued from previous page...




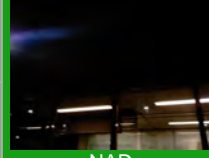
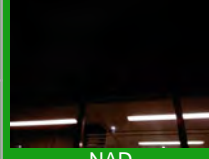
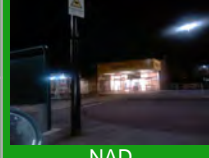
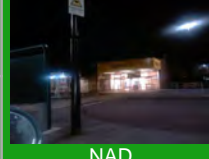
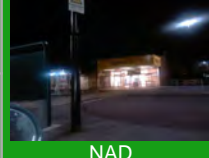

Building: Heworth Metro Station			Level: 99	Location: 001/External Canopy			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to rear of v.e panel 010	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 011	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 012	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 013	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 014	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 015	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 016	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 017	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 018	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...







Building: Heworth Metro Station				Level: 99		Location: 001/External Canopy	
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to rear of v.e panel 019	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 020	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 021	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 022	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 023	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 024	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 025	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 026	No Asbestos Identified	NAD	--	--		<div><div>NAD</div></div>
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 027	No Asbestos Identified	NAD	--	--		<div>NAD</div>
	(inspected during Survey, Survey, Management)						

table continued from previous page...

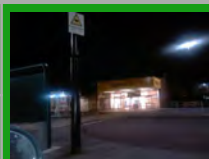



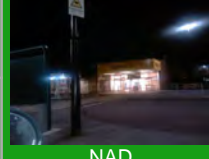



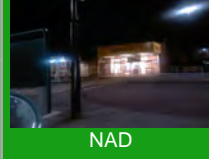

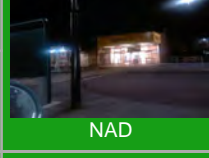

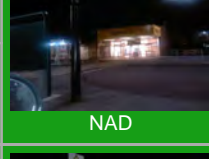

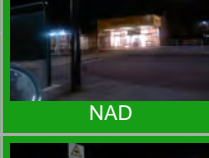



Building: Heworth Metro Station			Level: 99	Location: 001/External Canopy			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to rear of v.e panel 028	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 029	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 030	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 031	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 032	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 033	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 034	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 035	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 036	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

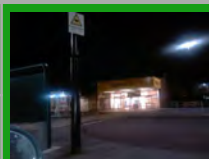

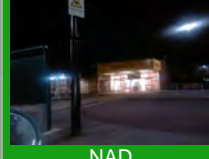

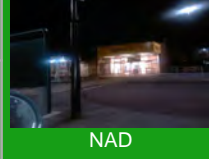
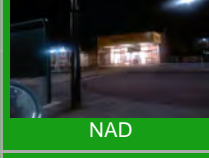
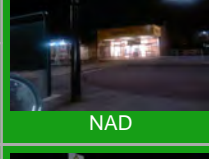
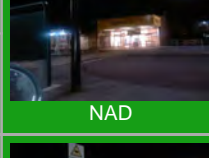

Building: Heworth Metro Station			Level: 99	Location: 001/External Canopy			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to rear of v.e panel 037	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 038	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 039	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 040	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 041	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 042	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 043	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 044	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 045	No Asbestos Identified	NAD	--	--		 NAD
	(inspected during Survey, Survey, Management)						

table continued from previous page...

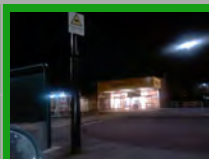







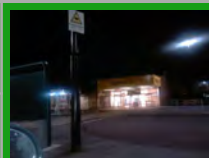

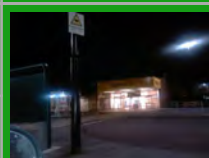
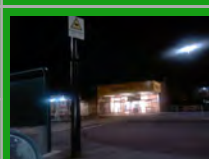



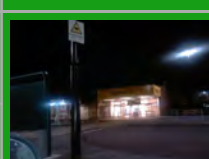

Building: Heworth Metro Station			Level: 99	Location: 001/External Canopy			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to rear of v.e panel 046	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 047	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 048	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 049	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 050	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 051	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 052	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 053	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 054	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

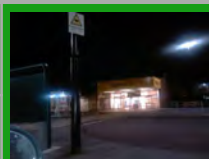



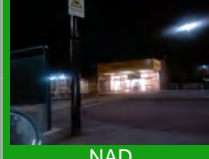



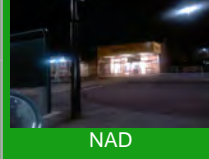

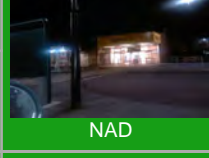

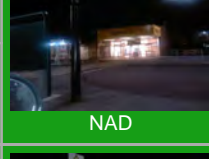

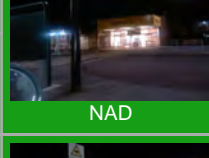













Building: Heworth Metro Station			Level: 99	Location: 001/External Canopy			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Insulating board to rear of v.e panel 055	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 056	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 057	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 058	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 059	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 060	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 061	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 062	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
	Insulating board to rear of v.e panel 063	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Heworth Metro Station				Level: 99	Location: 001/External Canopy			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Insulating board to rear of v.e panel 064	No Asbestos Identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 065	No Asbestos Identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 066	No Asbestos Identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulating board to rear of v.e panel 067	No Asbestos Identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Insulation to ceiling	No Asbestos Identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Stramit to canopy soffit	No Asbestos Identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							
	Firebreak	No Asbestos Identified	NAD	--	--		 NAD	
	(inspected during Survey, Survey, Management)							

Building: Heworth Metro Station				Level: 99	Location: 001/Platform 2 network rail			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	VE panel 02	No Asbestos Identified	NAD	--	--		NAD	
	(inspected during Survey, Survey, Management)							
	VE panel 03	No Asbestos Identified	NAD	--	--		NAD	
	(inspected during Survey, Survey, Management)							
	VE panel 04	No Asbestos Identified	NAD	--	--		NAD	
	(inspected during Survey, Survey, Management)							

table continued from previous page...

Building: Heworth Metro Station				Level: 99	Location: 001/Platform 2 network rail			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	VE panel 05	No Asbestos Identified	NAD	--	--		NAD	
	 (inspected during Survey, Survey, Management)							
	VE panel 10	No Asbestos Identified	NAD	--	--		NAD	
	 (inspected during Survey, Survey, Management)							
	VE panel 06	No Asbestos Identified	NAD	--	--		NAD	
	 (inspected during Survey, Survey, Management)							
	VE panel 07	No Asbestos Identified	NAD	--	--		NAD	
	 (inspected during Survey, Survey, Management)							
	VE panel 08	No Asbestos Identified	NAD	--	--		NAD	
	 (inspected during Survey, Survey, Management)							
	VE panel 09	No Asbestos Identified	NAD	--	--		NAD	
	 (inspected during Survey, Survey, Management)							
R3	VE panel 11	Insulating Board Insulating Board	Amosite, Chrysotile Amosite, Chrysotile	7 8	-- 1 No.	-- Reinspect Periodically	 R3	
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
R3	VE panel 12	Insulating Board Insulating Board	Amosite, Chrysotile Amosite, Chrysotile	7 7	-- 1 No.	-- Reinspect Periodically	 R3	
	 (inspected during Survey, Survey, Management)  Item condition unaltered since last inspection.							
	VE panel 01	No Asbestos Identified	NAD	--	--		NAD	
	 (inspected during Survey, Survey, Management)							