

# Site Asbestos Compendium Summary

This compendium report is based on Site id: **98937**, Client Ref: , Account Ref No: **3074**

## Byker Metro Station Corbridge Road Newcastle upon Tyne Tyne and Wear NE6 1HY

This Site Asbestos Compendium Summary report has been produced at the request of Tyne and Wear Metro T/a Nexus it is a summary of asbestos survey findings. Not all of this buildings or items within may have been surveyed for asbestos containing materials - check for exceptions below. Information in this report should not be regarded as an exhaustive inventory of all asbestos containing materials on these premises. Any proposed work of an intrusive nature in the vicinity of asbestos containing material as identified in this summary MUST in the first instance be referred to Tyne and Wear Metro T/a Nexus building and civil section.

This Compendium Asbestos report aims to be concise, yet comprehensive compilation of asbestos records relating to *Byker Metro Station Corbridge Road Newcastle upon Tyne Tyne and Wear NE6 1HY*. This compendium will summarize larger work shown in individual reports undertaken for jobs carried out on this site.

The full Site Asbestos Compendium report can be found at:

<https://web.lucion.co.uk/print/compendium/98937?s=df88b30551eef65b562b8247feb39f6e>

## Cover Photo





Most Recent Site Photo

## Overview of Jobs carried out at this Site

Job ID	Job-Type	Start Date	Due Date
187882	Survey, Management		
134414	Air Test, Reassurance	Monday, 19th September, 2016	Wednesday, 21st September, 2016

## Breakdown of Asbestos findings

 Asbestos should be presumed to be present within Locations and Items not accessed until further assessment.  Additional surveyor comments.

[↓ Previous Asbestos Records](#)
[Most Recent Asbestos Records ↓](#)

Building: Byker Metro Station				Level: 0	Location: 001/Station platform			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Internal panel to extinguisher dry riser	No Asbestos Identified	NAD	--	--			
	(inspected during Survey, Survey, Management)						NAD	
	VE panels	Asbestos Insulating Board	--	--	--	--		
	(inspected during Survey, Survey, Management)						PRESUME	
	Seal to dry riser panel	No Asbestos Identified	NAD	--	--			
	(inspected during Survey, Survey, Management)						NAD	

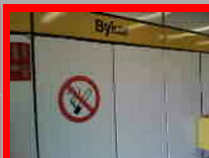

Building: Byker Metro Station				Level: 0	Location: 001/Station platform - Turning Chambers			
No reportable Items and Materials recorded at this Location								

Building: Byker Metro Station				Level: 0	Location: 002/Comms & Siggs room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Beige floor tiles	Composites	Chrysotile	3	--	--		
	(inspected during Survey, Survey, Management)						R3	

Building: Byker Metro Station				Level: 0	Location: 003/Void behind VE panel			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Beige floor tiles	Composites	Chrysotile	3	--	--		
	(inspected during Survey, Survey, Management)						R3	
	Gaskets to pipework	Friction Products	Chrysotile	4	--	--		
	(inspected during Survey, Survey, Management)						R3	

Building: Byker Metro Station				Level: 0	Location: 004/Station platform			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Internal panel to extinguisher dry riser	No Asbestos Identified	NAD	--	--			
	(inspected during Survey, Survey, Management)						NAD	

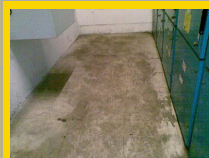

table continued from previous page...

Building: Byker Metro Station			Level: 0	Location: 004/Station platform			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	VE panels	Asbestos Insulating Board	--	--	--	--	 PRESUME
	💬 (inspected during Survey, Survey, Management)						
	Seal to dry riser panel	No Asbestos Identified	NAD	--	--		 NAD
	💬 (inspected during Survey, Survey, Management)						

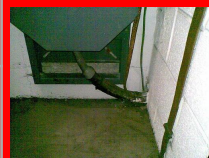

**Building: Byker Metro Station** **Level: 0** **Location: 004/Station platform - Turning Chambers**

No reportable Items and Materials recorded at this Location

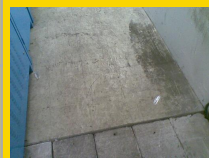

**Building: Byker Metro Station** **Level: 0** **Location: 005/LV room**

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Beige floor tiles	Composites	Chrysotile	3	--	--	 R3
	 (inspected during Survey, Survey, Management)						

**Building: Byker Metro Station** **Level: 0** **Location: 005/LV room**

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Bitumen wrap to cable	Bitumen Products	--	--	--	--	 <b>PRESUME</b>
	 (inspected during Survey, Survey, Management)						

**Building: Byker Metro Station** **Level: 0** **Location: 006/Battery room**

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Beige floor tiles	Composites	Chrysotile	3	--	--	 R3
	 (inspected during Survey, Survey, Management)						

**Building: Byker Metro Station** **Level: 0** **Location: 007/Void behind VE panel**





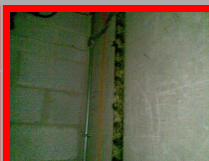

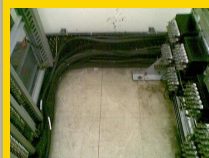












First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Beige floor tiles	Composites	Chrysotile	3	--	--	 R3
	 (inspected during Survey, Survey, Management)						
	Gaskets to pipework	Friction Products	Chrysotile	4	--	--	 R3
	 (inspected during Survey, Survey, Management)						

table continued from previous page...

Building: Byker Metro Station				Level: 0	Location: 007/Void behind VE panel			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Bitumen wrap to cable	Bitumen Products	--	--	--	--	 <b>PRESUME</b>	
	 (inspected during Survey, Survey, Management)							
Building: Byker Metro Station				Level: 0	Location: 008/Relay room			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Beige floor tiles	Composites	Chrysotile	3	--	--	 <b>R3</b>	
	 (inspected during Survey, Survey, Management)							
	Bitumen strip to floor	No Asbestos Identified	NAD	--	--		 <b>NAD</b>	
	 (inspected during Survey, Survey, Management)							
Building: Byker Metro Station				Level: 0.5	Location: 001/Station platform canopy			
No reportable Items and Materials recorded at this Location								
Building: Byker Metro Station				Level: 0.5	Location: 002/Station platform canopy			
No reportable Items and Materials recorded at this Location								
Building: Byker Metro Station				Level: 1	Location: 001/Cleaners store			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Cavity board behind VE panel	Asbestos Insulating Board	Amosite	7	--	--	<b>R3</b>	
	 (inspected during Survey, Survey, Management)							
Building: Byker Metro Station				Level: 1	Location: 002/Redundant kiosk			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Whole location	No Access Gained	--	--	--			
	 Limited Access:  (inspected during Survey, Survey, Management)							
Building: Byker Metro Station				Level: 1	Location: 003/Station concourse			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record	
	Internal panel to extinguisher dry riser	No Asbestos Identified	NAD	--	--		<b>NAD</b>	
	 (inspected during Survey, Survey, Management)							
	VE panels	Asbestos Insulating Board	--	--	--	--	 <b>PRESUME</b>	
	 (inspected during Survey, Survey, Management)							

Building: Byker Metro Station			Level: 1	Location: 004/Maintenance accommodation			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	Sink pad	No Asbestos Identified	NAD	--	--		 NAD
	 (inspected during Survey, Survey, Management)						
Building: Byker Metro Station			Level: 1	Location: 005/Ablutions			
No reportable Items and Materials recorded at this Location							
Building: Byker Metro Station			Level: 1	Location: 006/Corridor			
No reportable Items and Materials recorded at this Location							
Building: Byker Metro Station			Level: 1	Location: 007/Female toilet			
No reportable Items and Materials recorded at this Location							
Building: Byker Metro Station			Level: 1	Location: 008/Male toilet			
No reportable Items and Materials recorded at this Location							
Building: Byker Metro Sub Station			Level: 0	Location: 001/Substation Operations room			
No reportable Items and Materials recorded at this Location							
Building: Byker Metro Sub Station			Level: 0	Location: 002/Substation LV room			
No reportable Items and Materials recorded at this Location							
Building: Byker Metro Sub Station			Level: 0	Location: 003/Substation HV room			
No reportable Items and Materials recorded at this Location							